
Like or even more than the human eye



Vision System FH Series

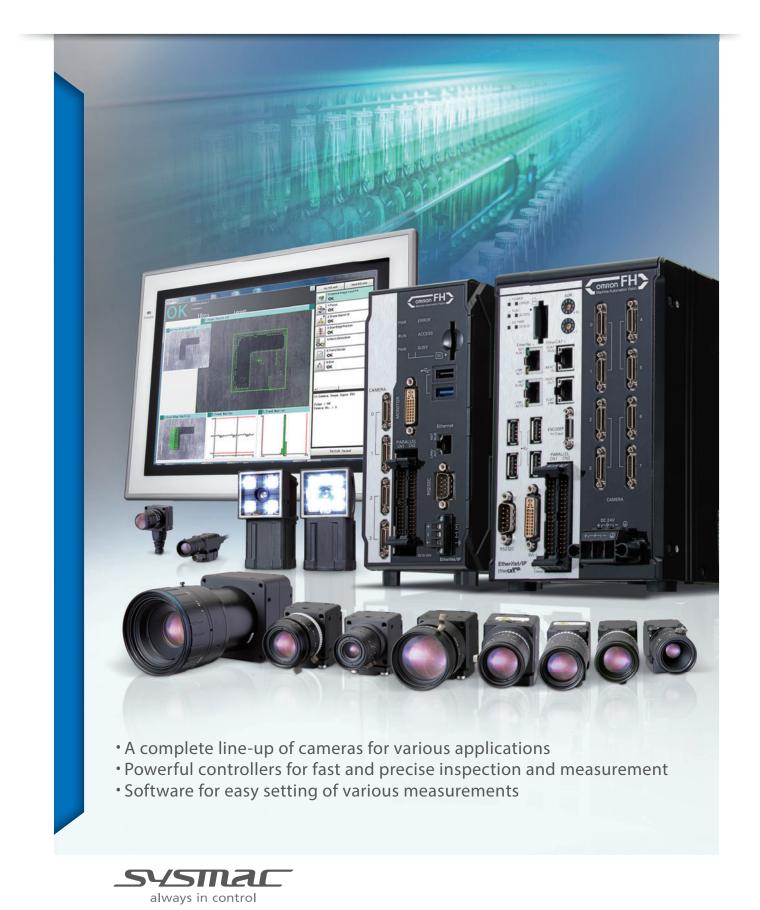

Best-in class image sensing speed and precision - like or even more than the human eye

Omron has packed image sensing technology for inspection and measurement necessary for automation into compact devices. The FH Series includes software for inspection and measurement in addition to cameras that can capture high-sensitivity and high-resolution images. This vision system, substituted for the human eye, provides high-speed and high-precision inspection and measurement without complex programming and device combination.



A complete line-up of cameras for various applications





Software for easy setting of various measurements

A complete line-up of cameras for various applications

For applications requiring high speed and high resolution

Lens mount camera

You can select the best combination of camera and lens for your application.





Rolling shutter camera added to the line-up

The benefits of cost-effective rolling shutter cameras are now being recognized once again.

The rolling shutter camera scans the pixels of each line. Although this produces distortions of moving objects, high-resolution yet cost-effective inspection and measurement can be performed.

Easy to install into machines

Camera with built-in light

The all-in-one camera including the light and lens can be easily integrated into almost any machine. * The FQ2 Smart Cameras are also available.

High-power lighting

The sensor has a built-in high-power light capable of evenly lighting across a wide field of view.


This provides sufficient lighting even when the enclosed polarizing filter is used.

Adjustable lens

The focus of the lens can be adjusted to take clear images for the specific field of view and installation distance you need.



Intelligent Compact Camera FZ-SQ____F(N)



Focus adjustment screw



For narrow space

Small camera

The ultra-compact lens can be installed into limited space in a machine. Select the flat or pen type depending on space.



This is the size with nothing otherthan a lens (FZ-LES3).

OMRON | 5

FH'

Powerful controllers for fast and precise inspection and measurement


You can select the best controller to suit requirements.

All controllers can share the same settings, bringing flexibility to machine design.


	FH-3050 Series	FH-1050 Series	FH-L550 Series
Processing speed (CPU)	Core Core Core Core	Core Core	Core Core
	4 core High speed	2 core High speed	2 core Mid speed
No. of connectable cameras	2 to 8	2 to 8	2 to 4
Multi-line processing	\checkmark	\checkmark	
Ether CAT	\checkmark	✓	
EtherNet/IP	\checkmark	\checkmark	\checkmark
Connectable camera		All FH and FZ cameras	

Image transfer without delay

The FH-3050/-1050 Series has a high-performance bus to transfer images, maximizing the specifications of any connected camera.

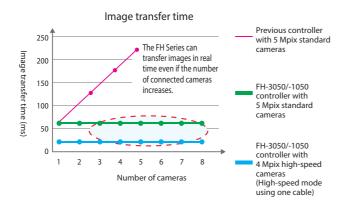

The FH-3050/-1050 Series can transfer large amounts of image data in real time.

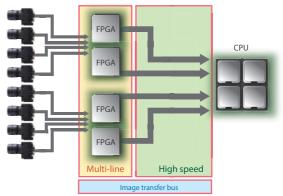


Note: The image conversion processing time is not included.

Object detection algorithm Shape Search III for fast and precise inspection and measurement

High-precision object detection


Low-error position detection even with blurry images

Over many years, Omron has perfected techniques to search for and match templates at high speed. This experience and expertise enables us to develop the Shape Search III vision algorithm, which provides advanced robustness and is critical on FA sites. When measuring lamination of glass or other processes where the distance to the workpiece from the camera varies, size differences and focal shifts can occur. Even in cases like this, the new Shape Search III algorithm detects positions with limited error.

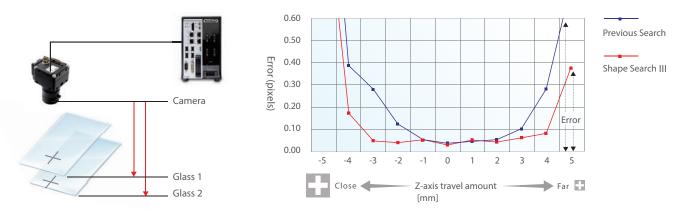


Stable searching with limited error even under adverse conditions

Stable searching is possible even under the following adverse conditions, which occur far too often in actual measurement applications.

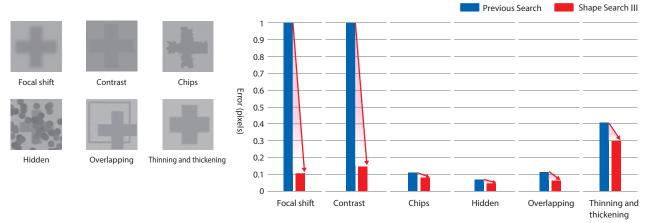

Detection of multiple workpieces

Even if many workpieces are within the field of view, searching is possible without compromising detection accuracy.




The different types of the searched workpieces can be classified.



Detection of workpieces from background noise and detection of shiny workpieces Stable searching is possible without being affected by the

Stable searching is possible without being affected by the background or gloss.





What is Think & See?

Powerful core technologies for image sensing. Omron is continuously developing technologies to measure, detect, or identify the positions, orientations, shapes, materials, colors, status, or attributes of things, people, vehicles, or other objects faster, more precisely, and more easily than the human eye under various conditions. Shape Search III is based on the Think & See technology.




See the details of Think & See.

http://www.omron.com/technology/core/thinkAndSee/

Ultra-high-speed searching 9 times faster than before

New technology makes search algorithms up to nine times faster than before. Even for unstable image conditions (including light interference, overlapping shapes, gloss, and incomplete images), stable searching is now possible without reducing speed.

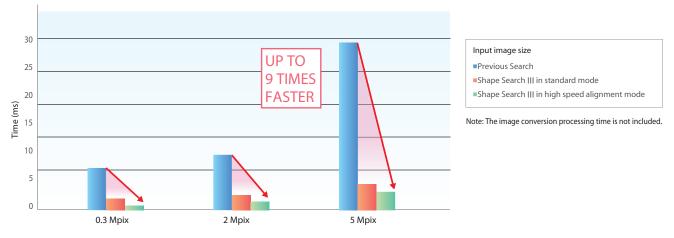


Ultra-high-speed search processing time


Visualization of comparisons enables easy setting of

high-precision searching Patent Pending

Advanced searching is accompanied by many parameters that must be tuned to match the application. However, it is difficult for the person making the settings to see the internal process. Normally, a lot of time and effort is required to maximize tool performance. But with Shape Search III, you can visualize comparisons between the model data and a part of the measurement object to easily see when comparisons are not optimally matched. Visualization of the comparison level allows for parameters to be adjusted to quickly obtain the best performance.



You can see at a glance the difference between the registered model and measurement image




You can adjust a parameter called the Acceptable Distortion Level to enable measurements without reducing the correlation even if there is distortion. You can easily adjust this parameter while monitoring the comparison.

Preinstalled GUIs - for designers and for operators

GUI for operators

Operation interfaces are preinstalled in the FH Series.

You can display operation interfaces just by switching screens, without time-consuming interface development work.

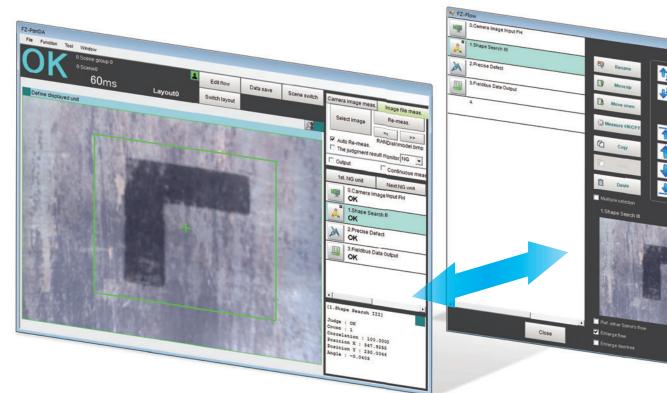

Choose any of nine languages

You can change display messages between nine different languages: English, Chinese, Japanese and other languages. Display the best language for the user for applications in other countries.


Touch screen ideal for on-site operation



The IP65-certified touch screen for the FH Series is available (FH-MT12). The resistive film method allows easy operation with a gloved hand.

Easy customization of interface

Operation screen

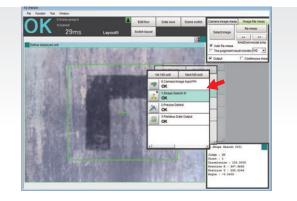


You can easily customize the preinstalled interfaces just by dragging and dropping.



GUI for designers

The setting of inspection and measurement can be done by combining processing items to create a flow. GUI for detailed setting for measurement conditions allows intuitive operation.

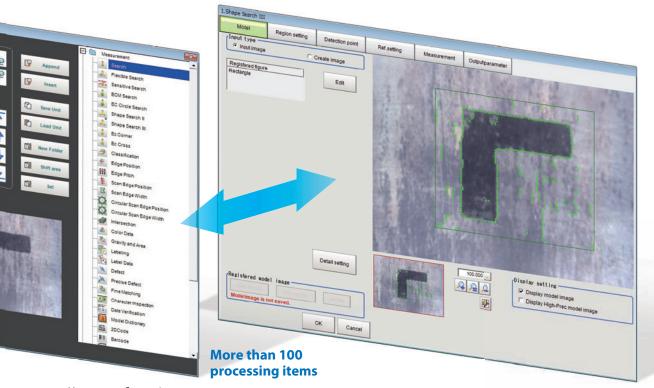

Measurement flow setting screen


Measurement condition setting screen

Inspection flow design



Drag and drop processing items to create inspection and measurement flows. Flow creation at production sites, offline flow creation, and simulations are possible.

Simple programming

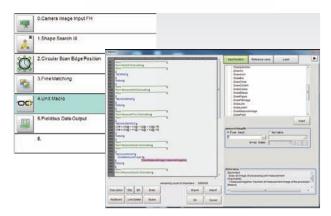


User-defined macro can be used for complex data processing that cannot be performed by inspection flows. The BASIC-like programming language facilitates the macro creation.

Flexible functionalities to provide high compatibility with manufacturing machines

Remote operation via Ethernet


The Remote Operation Tool is provided to control the FH Series from a remote location via Ethernet. Just install the tool on your PC and specify the IP address.

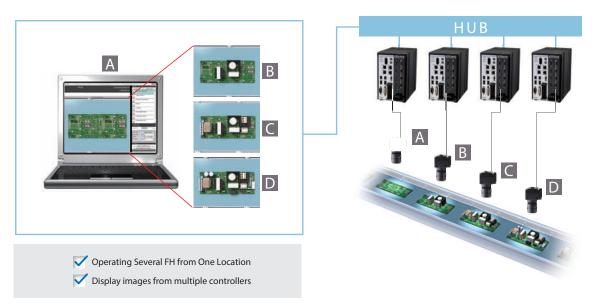

Note: Ask your OMRON representative about obtaining simulation software for a computer.

Integration into user applications

Microsoft.Net software components are supported to integrate the FH interfaces into a PC-based HMI. You can add components that display FH screens and measurement results to your HMI software just by dragging and dropping.

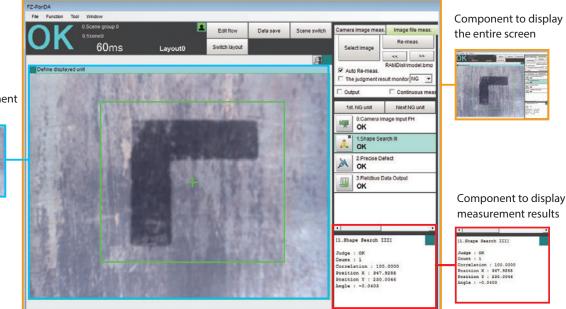

Component to display measurement images



Note: Ask your OMRON representative about the software components.



Integrated development environment

The Automation Software Sysmac Studio integrates setting and operation of the NJ/NX Machine Automation Controller and FH Series. Simulate and debug motion control, logic, drives, and sensing on an integrated platform to reduce the work required for machine design.


Vision system simulation

Inspection and measurement by vision systems can be simulated from the Sysmac Studio.



Data tracing Inputs and outputs of vision systems can be traced as a time series. **3D Simulation** Patent Pending

Machine movement can be simulated based on measurement results of vision systems.

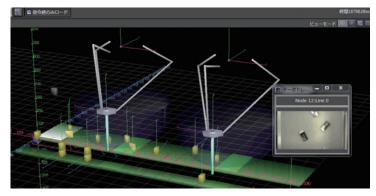

Software customization

The Application Producer (FH-AP1) provides a development environment that lets you customize software preinstalled in the FH Controller. Original interfaces created with Microsoft Visual Studio can be used with the FH Controller.





Create installation files for the FH Controller with Application Producer

12 | FH Series

High immunity against ambient light for reliable inspection



Glue bead and shape inspection application

Even workpieces with surfaces that are difficult to inspect (e.g. metal cutting surface) can be reliably inspected.

Inspection flow example

-	0.Camera Image Input HDR	
20	1 Iris	
2	2.Focus	
-	3.Image Subtraction	
1	4.Glue Bead Inspection	



The Camera Image Input HDR processing item can create optimized HDR images under variable ambient conditions. Normally, to create a HDR image, you must set the imaging conditions for each shooting. However with the FH Series, once you specify the area to capture on the image, the vision system automatically adjusts the shutter speed while capturing images and combines the images.



Optimized for the bright part

Image optimized for the specified area



Optimized for the entire field of view

Optimized for the dark part

Optimum focus and aperture settings

Until now, focus and brightness settings were adjusted according to experience and intuition. But now they can be evaluated numerically and visually on graphs. This allows quick verification of optimum focus and aperture settings to eliminate inconsistencies in settings caused by worker differences so that you can achieve even higher levels of measurement accuracy.





- Camera installation and setup are easy.
- Errors can be generated when the focus or aperture changes.
- You can determine the numerical values for the focus and aperture for the master workpiece so that essentially anyone can reproduce the same conditions.

OMRON | 13

Extraction of objects to inspect


When the complete sealing is inspected, the effects of unstable conditions can be eliminated by updating the image that is captured before applying the sealant and registered as the master. The FH Series can easily update the master image to extract the difference just by using the Image Subtraction processing item.Image Subtraction processing item.




The Glue Bead Inspection processing item evaluates sealing numerically just by defining the start and end points of the object to inspect. This minimizes inconsistencies in inspection. Even complex paths can be detected accurately.

Unlike the general width inspection using edges, the profile of the object is used to inspect.


This method enables accurate inspection of complex curves and interruptions.

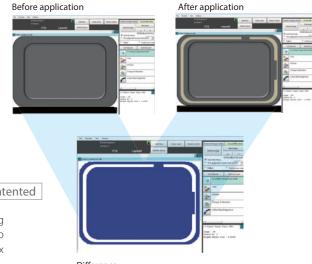

Difference

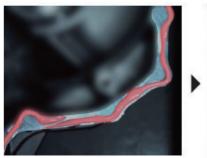

Original image

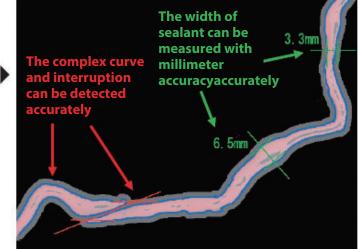


Parallel processing for high-speed inspection




In-line external inspection application on high-speed production lines

The FH Series provides various functions for in-line inspection requiring fast inspection speed.

Inspection flow example

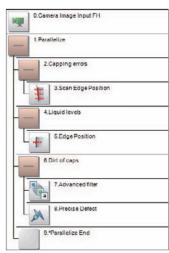

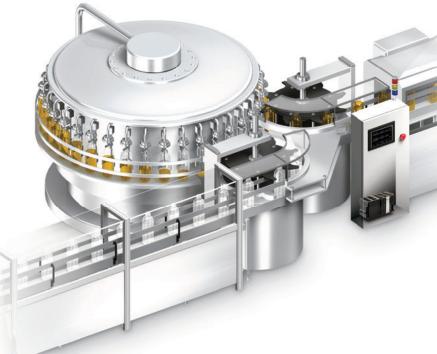


Trigger interval reduced by up to 75%

Generally, when multiple inspections are performed simultaneously, the waiting time until the next inspection occurs. Parallel processing on multi-core CPU greatly speeds up inspection by eliminating waiting time.



Multi-input functionContinuous high-speed image captureHigher speed from advanced image
capture and parallel measurements

Each camera has its own image buffer for storing image data. This is separate from the main memory that is used for measurement processing. This allows for up to 256 frames* of continuous high-speed image capture even when the main memory is processing measurement data.

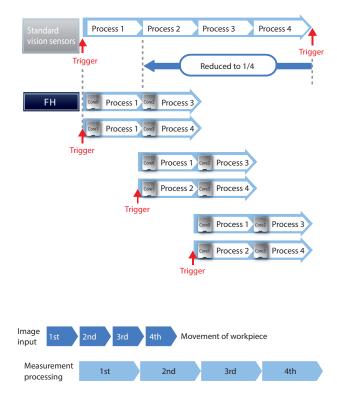

* The number of images that can be captured depends on the controller and the camera that is connected to it. Refer to the user's manual for details.

Image creation technology to maximize inspection capability


Real Color Sensing



Patented

The FH Series features Omron's unique Real Color Sensing. High-speed processing using color information enables high-accuracy detection of edges and defects.

Color segmentation processing



Color images taken by the camera are processed after being converted into black and white pixels. Based on minimum information, high speed processing is possible. Since color data is limited only to brightness, however, it takes a long time to make optical adjustments for extracting color features.



Color images are converted into 256 levels of black-and-white brightness and the contrasts of specific colors are enhanced. More precise, stable results can be produced compared to color segmentation. However, this method has difficulty in capturing subtle variations in color because all colors are converted into black-and-white brightness levels. Therefore, it is difficult to detect subtle changes in images with low contrast.

Real Color Sensing



Color variatic between 16.7 million differ colors can be captured without any color loss.

Edges are detected reliably even when the contrast between the background

and subject is low.

Different colors are represented as different positions in the 3D RGB space. Subtle variations in color can be recognized by representing them as distances between different color pixels comprising this space. Thus, scratches and dirt can be detected accurately even in images with low contrast.

Previous image processing

Omron FH Series

Stripe Removal Filter II

This processing item filters out the stripped pattern or other background. Reliable defect inspection can be achieved by extracting minute changes such as defects.

Unfiltered image



Due to the stripes, inspection is possible only in the very center of the image. To inspect the entire surface, the cap must be rotated and many images must

be taken.

External appearance of bottle cap e Image after Stripe Removal Filter




Because even the defect at the edge of the image can be detected, the number of images that is required to inspect the entire cap is greatly reduced.

Utilities

High-speed logging to save all images even during measurements

The CPU can perform parallel processing of measurements and image logging. With high-speed connection to a high-capacity (3 TB) HDD, all images on the high-speed line can be saved, which was previously difficult. Trend analysis of all saved images quickly isolates errors and facilitates countermeasures.

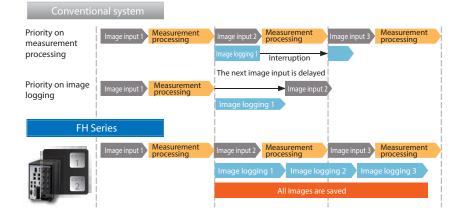

*1. All images can be saved under the following conditions:
•300,000-pixel camera x 1 unit
•Measurement time: 20 ms

 Images can be saved continuously for approx. 5 days when a 3 TB HDD is used (based on 8 hours of operation a day)

lssue

Since logging was not possible during measurement, the user had to choose either measurement or logging. Accordingly, not all images could be saved or image input triggers had to be delayed depending on the measurement trigger intervals.



Measurement and image logging are processed completely in parallel. As a result, you can save all images.

Robust to adverse conditions and easy to set



A single sensor can perform everything, from GS1 code reading to image inspection, which saves costs and space in Track & Trace application.

Inspection flow example

噢	0.Camera Image Input FH	
OCR	1.0CR	
	2.Barcode	



OCR is based on the Think & See technology, Omron's image sensing technology. See the details of Think & See

Stable reading of difficult-to-read 0 characters

Printed characters can be too close to each other, and characters can be printed on curved surfaces. Even in these cases, stable reading is now possible.



Multi-line random processing

A single FH-3050/-1050 Controller can perform completely different inspections. Controllers installed for each inspection can be integrated into one, which reduces initial costs and save space.

Easy installation with built-in dictionary

Reads code

Reads characters

Many previous character reading methods required dictionary setup before usage, which was a tedious step. The built-in dictionary developed through Omron's long and rich experiences on FA sites includes a variety of fonts and possible character variations, eliminating the need of dictionary setup. You can also add non-conventional characters when special fonts are read.

Both a code reader and a vision sensor were


used for inspection

3 Judges printing quality of code

4 Compares code data

with character data

Characters from most printers can be read, including dot and





OMRON | 17

Easy commissioning of complex systems



Conveyor tracking application

The FH-1050/-3050 Controller provides the functionality to help you build the conveyor tracking system that is difficult to build because of complicated calibration.

Calibration synchronized with conveyor control can be performed via EtherCAT.

Calibration Wizard Patent Pending

Easy on-site calibration

To detect positions of workpieces carried on a conveyor and grip them with a robot hand, three different coordinate systems for the robot, conveyor, and vision must be aligned. With the FH Series, you can easily calibrate the entire system using a step-by-step wizard.



Calibration plate for wizard



From the Sysmac Studio you can print the calibration plate in various sizes, from 30 mm to 2,000 mm, according to the size of the conveyor or camera field of view


Removing duplication Patent Pending

Workpieces that overlap within more than one field of view are segregated and only inserted in the picking line once. You can eliminate the need to create the program for the machine controller to identify the same workpiece.

STEP1


Start the Calibration Wizard from the Sysmac Studio, and capture the image of the calibration plate.

Move the calibration plate into the tracking area, and let the robot touch the target mark to automatically obtain the robot coordinates.



STEP2

First shot The positions and orientations of workpieces 1 to 5 are detected and added to the picking line.



STEP3

completed.

The FH Controller automatically

calculates by using the data

including the conveyor travel


robot and FH Vision System is

distance. Calibration between the

Next shot Workpieces 4 to 8 are detected, but only the data of 6 to 8 is evaluated. The data of 4 and 5 is ignored because it was already added to the line.


Check ideal shooting intervals on panorama view Patented

The Conveyor Panorama Display Tool allows you to view the measurement trigger input intervals to ensure all workpieces can be detected.

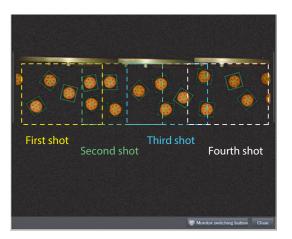

18 | FH Series

Reliable execution of complex inspection

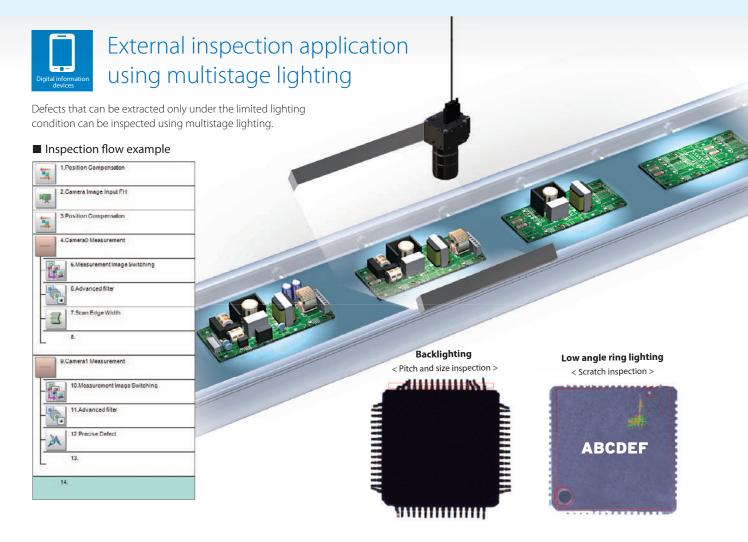

Light switching control


You can perform the inspection using images captured under different conditions by inputting multiple images in a inspection flow. The FH Series can capture images required for each inspection while changing the lighting conditions depending on inspection.

Easy light installation and setting

The use of camera-mount lighting controller eliminates the needs of power supply for lights and lighting cables, saving space and wiring. As the controller can switch lights and control brightness, you do not need to set from an external device.

Connect up to 32 lights for multistage control

You can perform multistage control with up to four lights connected to each electronic flash controller. If eight cameras are connected, up to 32 lights can be connected to the FH Controller.

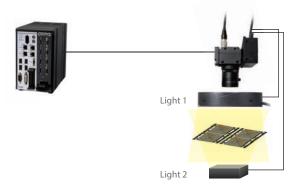

Automatic generation of measurement regions

A measurement region of any shape can be automatically set by specifying a part of the area to inspect. A region of a complex shape can be set with a few operations.

Specify a part of the area to inspect




specified areas or shapes

is possible.



This filter uses label processing to output an extracted image that contains only the specified characteristic labels.

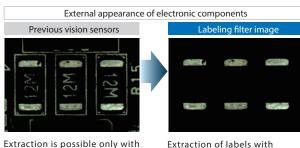


Extraction is possible only with color or brightness information.

Custom filter

You can set the mask coefficients as required for these filters. The mask size can be up to 21 x 21. You can more flexibly set image smoothing, edge extractions, dilation, and erosion.

Example: Dilation/erosion in one direction

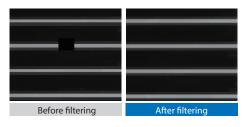

Filter coefficients

	∑ 1 ∑ 1		
	· 1 · 1		
	☑1 ☑1		

You can set the filter coefficients as required.


A measurement region is automatically generated from the consecutive areas in the same color





Calculations between images

You can perform arithmetic operations, bit operations, averaging, or maximum/minimum operations between two images.

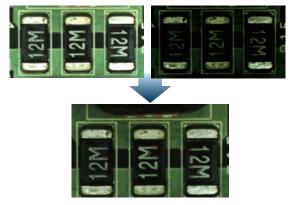

Example: You can get the average of two images that were taken under different conditions.



Brightness correct filter

This filter cuts out uneven lighting and changes in brightness caused by workpiece surface irregularities to make characteristic features stand out clearly.

	External a	ppearance of battery pack
Befo	re filtering	Image after brightness correct filter
Reflection	Defect	

Shadow The wavy inconsistencies are judged as defects.



that only the defect appears in the inspection.


High-speed and high-precision stage alignment



Automatic precise calibration

Just execute the flow created for calibration to complete calibration for stages.

Calibration flow example

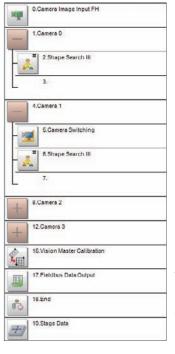


Optimized workpiece sampling

Previous Methods

With the previous method, the user specifies the sampling points for calibration.


If the rotation angle is not wide enough, the calibration accuracy is low.

FH Series



The FH Series automatically calculates sampling points that maximize the rotation angle by combining parallel movement with rotation movement within the travel range of the stage.


High calibration accuracy that is not dependent on operator skill is assured.

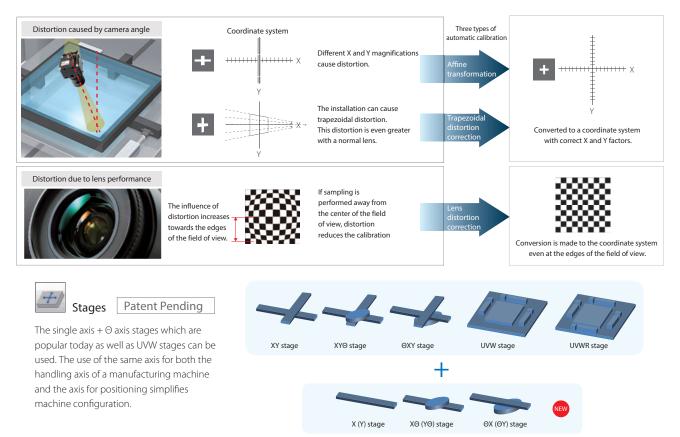

High-speed and high-precision positioning


High-precision positioning can be performed by referencing calibration parameters. Fast object detection and calculation by utilizing parallel processing increase machine speeds.

■ Alignment flow example

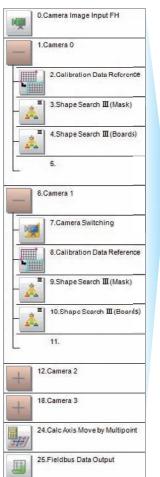

B Parallel processing

Object detections using multiple cameras are performed in parallel. Pipeline processing enables fast detection without waiting.

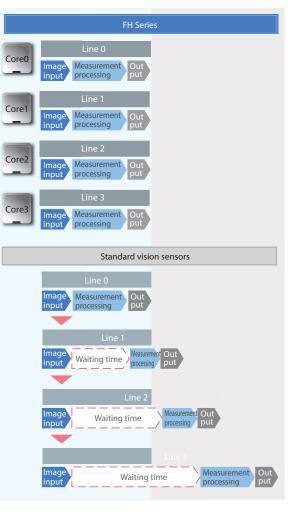


111


Available alignment methods

The processing items specialized for alignment calculations are provided, enabling flexible positioning of any workpiece.






•Alignment with side measurements



·Alignment using corresponding points



Shortened by approx. 6 ms


Data communications cycle 125 µs

EtherCAT machine control network

You can use EtherCAT to connect NJ/NX Machine Automation Controllers and motion control G5 Servomotors and Servo Drives for high-speed control from workpiece detection to starting axis motion.

Communications cycle

EtherCAT

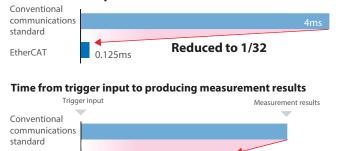

Note: The times given above are typical times. They depend on parameter settings.

Versatile selection

You can select the best combination of camera and controller for your application. Software assets can be shared between controllers. This allows you to Install devices with the capabilities you need, anywhere you need them.

Cameras

Choose the right camera to suit your resolution requirements. Easy-to-use cameras with built-in light are also available.

Resolution	Standard camera	High-speed camera	Rolling shutter camera	Camera with built-in light
12 Mpix	-	FH-SD12	-	-
5 Mpix/ 4 Mpix	FZ-S□5M	FH-S□04	FH-S□05R	-
2 Mpix	FZ-S□2M	FH-SD02	-	-
0.3 Mpix	FZ-S□	FH-S□	-	FZ-SQ 🗆 🗆 🗆

FH Controllers

Select a controller based on the required processing speed and network.All controllers can connect to any camera.



Lights

Omron offers a complete line-up of lights required for image processing. The use of the camera-mount lighting controller allows you to control lighting conditions from the FH Series, making machine configuration simple.

Description	LED	High-brightness LED
Camera-mount Lighting Controller	FLV-TCC	FL-TCC
Bar Light	FLV-BR	FL-BR
Direct Ring Light	FLV-DR	FL-DR
Low Angle Ring Light	FLV-DL	-
Coaxial Light	FLV-CL	-
Shadowless Light	FLV-FR/FP/FS/FQ	-
Spot Light	FLV-EP	-
Direct Back/Edge Type Ligh	FLV-DB/FB	-
Dome Light	FLV-DD	-

Camera cables

The cable line-up includes handy bend-resistant cables and right-angle cables. Use the FZ-VSJ Cable Extension Unit for further extension of the cable.

Description	Model
Camera Cable	FZ-VS3 🗆
Right-angle Camera Cable	FZ-VSL3
Bend-resistant Camera Cable	FZ-VSB3 □□
Bend-resistant Right-angle Camera Cable	FZ-VSLB3
Cable Extension Unit	FZ-VSJ

Refer to the Vision Accessory Catalog (Cat. No. Q198) for details.

Application Producer

This software enables you to install applications you created on the FH Series.

Description	Model
DVD for installation	FH-AP1
Software license	FH-AP1L



No. of connectable
camerasFieldbus8 max.EtherNet/IP,EtherCAT8 max.EtherNet/IP,EtherCAT4 max.EtherNet/IP



Touch panel monitor

The touch panel monitor is optimized for the operation of the FH Series.

Description	Model
Touch Panel Monitor 12.1 inches	FH-MT12
DVI-Analog Conversion Cable for Touch Panel Monitor	FH-VMDA
USB Cable for Touch Panel Monitor	FH-VUAB

*RS-232C cables for long-distance connections are also available. Refer to Ordering Information for details.

Ether CAT.

EtherNet/IP



Vision System FH-Series

Like or even more than the human eye


- A complete line-up of cameras for various applications
- Powerful controllers for fast and precise
 inspection and measurement
- Software for easy setting of various measurements



System configuratio

EtherCAT connections for FH series

Example of the FH Sensor Controllers (4-camera type)

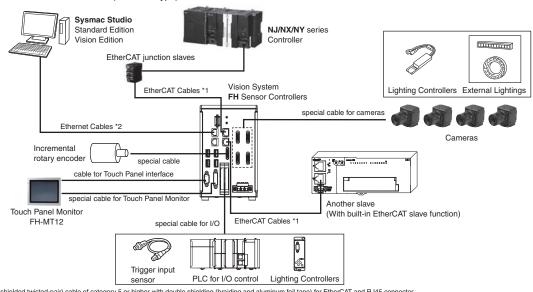

*1. To use STP (shielded twisted-pair) cable of category 5 or higher with double shielding (braiding and aluminum foil tape) for EtherCAT and RJ45 connector. *2. To use STP (shielded twisted-pair) cable of category 5 or higher for Ethernet and RJ45 connector.

Ordering Information

FH Series Sensor Controllers

Item		CPU	No. of cameras	Output	Model
		High-speed	2	NPN/PNP	FH-3050
		Controllers	4	NPN/PNP	FH-3050-10
	Box-type	(4 core)	8	NPN/PNP	FH-3050-20
	controllers	Standard	2	NPN/PNP	FH-1050
		Controllers	4	NPN/PNP	FH-1050-10
		(2 core)	8	NPN/PNP	FH-1050-20
Box-type	Box-type	Lite Controllers	2	NPN/PNP	FH-L550
controllers		(2 core)	4	NPN/PNP	FH-L550-10

Cameras

	Item	Descriptions	Color / Monochrome	Image Acqui- sition Time *1	Model
	High-speed Digital CMOS Cameras	12 million pixels (Up to four cameras can be connected to one Controller. Up to eight cameras other than	Color	25.7 ms *2	FH-SC12
Chine .	(Lens required)	12 million-pixel cameras can be connected to a FH-3050-20 or a FH-1050-20.)	Monochrome		FH-SM12
		4 million pixels	Color	8.5 ms *2	FH-SC04
		4 minor pixels	Monochrome	0.51115 2	FH-SM04
	High-speed Digital	2 million pixels	Color	4.6 ms *2	FH-SC02
-	CMOS Cameras (Lens required)		Monochrome	4.0 1115 2	FH-SM02
		300.000 pixels	Color	- 3.3 ms	FH-SC
021		500,000 pixels	Monochrome	3.3 1115	FH-SM
	Digital CMOS Cameras		Color		FH-SC05R
1)	(Lens required)	5 million pixels	Monochrome	71.7ms	FH-SM05R
			Color	- 62.5 ms	FZ-SC5M2
002.0		5 million pixels	Monochrome		FZ-S5M2
	Digital CCD Cameras		Color	- 33.3 ms	FZ-SC2M
3-11 -	(Lens required)	2 million pixels	Monochrome		FZ-S2M
			Color	10.5	FZ-SC
0111 =		300,000 pixels	Monochrome	12.5 ms	FZ-S
	High-speed Digital		Color		FZ-SHC
ON P	CCD Cameras (Lens required)	300,000 pixels	Monochrome	4.9 ms	FZ-SH
			Color	10.5	FZ-SFC
11	Small Digital — CCD Cameras	300,000-pixel flat type	Monochrome	12.5 ms	FZ-SF
	(Lenses for small camera required)		Color	10.5 mg	FZ-SPC
Contraction of the		300,000-pixel pen type	Monochrome	12.5 ms	FZ-SP
Here .		Narrow view	Color		FZ-SQ010F
I	Intelligent Compact Digital CMOS Camera	Standard view	Color	16.7 ms	FZ-SQ050F
e	(Camera + Manual Focus Lens + High power Lighting)	Wide View (long-distance)	Color	10.7 MS	FZ-SQ100F
		Wide View (short-distance)	Color		FZ-SQ100N

*1 The image acquisition time does not include the image conversion processing time of the sensor controller. The camera image input time varies depending on the sensor controller model, number of cameras, and camera settings. Check before you use the camera.
*2 Frame rate in high speed mode when the camera is connected using two camera cables. For other conditions, please refer to the chart below.

Model		FH-SM02	FH-SC02	FH-SM04	FH-SC04	FH-SM12	FH-SC12	
	2 Cables *1	High Speed Mode *2	4.6ms		8.5ms		25.7ms	
Image Acquisition		Standard Mode	9.7ms		17.9ms		51.3ms	
Time	1 Cables	High Speed Mode *2	9.2ms 17.0ms)ms	51.3ms		
	Teables	Standard Mode	19.3ms		35.8ms		102.0ms	

*1 Two Camera ports of the controller are used per one camera.
 *2 Up to 5 m Camera Cable lengh.

Camera Cables

Item	Descriptions	Model *3
· O	Camera Cable Cable length: 2 m, 3 m, 5m, or 10 m *2	FZ-VS3 □M
Q,	Bend resistant Camera Cable Cable length: 2 m, 3 m, 5m, or 10 m *2	FZ-VSB3 □M
· •	Right-angle Camera Cable *1 Cable length: 2 m, 3 m, 5m, or 10 m *2	FZ-VSL3 □M
Ņ,	Bend resistant Right-angle Camera Cable *1 Cable length: 2 m, 3 m, 5 m, or 10 m *2	FZ-VSLB3 □M
Q	Long-distance Camera Cable Cable length: 15 m *2	FZ-VS4 15M
Ń,	Long-distance Right-angle Camera Cable *1 Cable length: 15 m *2	FZ-VSL4 15M
-	Cable Extension Unit Up to two Extension Units and three Cables can be connected. (Maximum cable length: 45 m *2)	FZ-VSJ

*1 This Cable has an L-shaped connector on the Camera end.
*2 The maximum cable length depends on the Camera being connected, and the model and length of the Cable being used. For further information, please refer to the "Cameras / Cables Connection Table" and "Maximum Extension Length Using Cable Extension Units FZ-VSJ table". When a high-speed Digital CMOS camera FH-S_02/-S_04/-S_12 is used in the high speed mode of transmission speed, two camera cables are required.
*3 Insert the cables length into □ in the model number as follows. 2 m = 2, 3 m = 3, 5 m = 5, 10 m = 10

Cameras / Cables Connection Table

				High-speed Digital CMOS cameras						
			300,000-pixel	2 millio	2 million-pixel 4 million-pixel			12 milli	on-pixel	5 megapixel camera
Type of	Model	Cable	FH-SM/SC	FH-SM)2/SC02	FH-SM	04/SC04	FH-SM	12/SC12	FH-SC05R/SM05R
camera	mouor	length	-	High speed mode of transmission speed select	Standard mode of transmission speed select	High speed mode of transmission speed select	Standard mode of transmission speed select	High speed mode of transmission speed select	Standard mode of transmission speed select	-
		2 m	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes
Camera Cables Right-angle	FZ-VS3 FZ-VSL3	3 m	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes
camera cables		5 m	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes
		10 m	Yes	No	Yes	No	Yes	No	Yes	Yes
Bend resistant		2 m	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes
camera cables Bend resistant	FZ-VSB3	3 m	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes
Right-angle	FZ-VSLB3	5 m	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes
Camera Čable		10 m	Yes	No	Yes	No	Yes	No	Yes	Yes
Long-distance camera cable Long-distance right-angle camera cable	FZ-VS4 FZ-VSL4	15 m	Yes	No	Yes	No	Yes	No	Yes	Yes

			l	Digital CCD cameras	6	Small digital	High-speed	Intelligent Compact
Type of	Model	Iodel Cable length	300,000-pixel	2 million-pixel	5 million-pixel	CCD cameras Pen type / flat type	Digital CCD cameras	Digital CMOS Camera
camera			FZ-S/SC	FZ-S2M/SC2M	FZ-S5M2/SC5M2	FZ-SF/SFC FZ-SP/SPC	FZ-SH/SHC	FZ-SQ□
		2 m	Yes	Yes	Yes	Yes	Yes	Yes
Camera Cables Right-angle	FZ-VS3 FZ-VSL3	3 m	Yes	Yes	Yes	Yes	Yes	Yes
camera cables		5 m	Yes	Yes	Yes	Yes	Yes	Yes
		10 m	Yes	Yes	No	Yes	Yes	Yes
Bend resistant	FZ-VSB3	2 m	Yes	Yes	Yes	Yes	Yes	Yes
camera cables		3 m	Yes	Yes	Yes	Yes	Yes	Yes
Bend resistant Right-angle	FZ-VSLB3	5 m	Yes	Yes	Yes	Yes	Yes	Yes
Camera Cable		10 m	Yes	Yes	No	Yes	Yes	Yes
Long-distance camera cable Long-distance right-angle camera cable	FZ-VS4 FZ-VSL4	15 m	Yes	Yes	No	Yes	Yes	Yes

Maximum Extension Length Using Cable Extension Units FZ-VSJ


		Transmission	No. of CH used	Maximum cable length	Max. number of	Using Cable Extension Units FZ-VSJ		
Item	Model	speed (*1)	for connection (*2)	using 1 Camera Cable (*1)	connectable Ex- tension Units	Max. cable length	Connection configuration	
	FH-SM/SC			15 m (Using FZ-VS4/VSL4)	2	45 m	[Configuration 1] Camera cable: 15 m × 3 Extension Unit: 2	
		Standard	1	15 m (Using FZ-VS4/VSL4)	2	45 m	[Configuration 1] Camera cable: 15 m × 3 Extension Unit: 2	
High-speed Digital CMOS Cameras	FH-SM02/SC02 FH-SM04/SC04	Standard	2	15 m (Using FZ-VS4/VSL4)	4 (*3)	45 m	[Configuration 2] Camera cable: 15 m × 6 Extension Unit: 4	
	FH-SM12/SC12	High speed	1	5 m (Using FZ-VS⊟/VSL⊟)	2	15 m	[Configuration 3] Camera cable: 5 m X 3 Extension Unit: 2	
			2	5 m (Using FZ-VS□/VSL□)	4 (*3)	15 m	[Configuration 4] Camera cable: 5 m × 6 Extension Unit: 4	
Digital CMOS Cameras	FH-SC05R FH-SM05R			15m (Using FZ-VS4/VSL4)	2	45 m	[Configuration 1] Camera cable: 15 m X 3 Extension Unit: 2	
Digital	FZ-S/SC FZ-S2M/SC2M			15 m (Using FZ-VS4/VSL4)	2	45 m	[Configuration 1] Camera cable: 15 m X 3 Extension Unit: 2	
CČD Cameras	FZ-S5M2/SC5M2			5 m (Using FZ-VS⊡/VSL⊡)	2	15 m	[Configuration 3] Camera cable: 5 m X 3 Extension Unit: 2	
Small Digital CCD Cameras Flat type/ Pen type	FZ-SF/SFC FZ-SP/SPC			15 m (Using FZ-VS4/VSL4)	2	45 m	[Configuration 1] Camera cable: 15 m X 3 Extension Unit: 2	
High-speed Digital CCD Cameras	FZ-SH/SHC			15 m (Using FZ-VS4/VSL4)	2	45 m	[Configuration 1] Camera cable: 15 m × 3 Extension Unit: 2	
Intelligent Compact Digital CMOS Camera	FZ-SQ□			15 m (Using FZ-VS4/VSL4)	2	45 m	[Configuration 1] Camera cable: 15 m × 3 Extension Unit: 2	

*1 The FH-S = enables switching between standard and high speed modes. In high speed mode, images can be transferred approximately two times faster than in standard mode, but the connectable cable length will be shorter.

*2 The FH-S has two channels to connect Camera Cables. Connection to two channels makes image transfer two times faster than connection to one channel: high speed mode using two channels can transfer approximately four times as many images as standard mode using one channel.

*3 Each channel can be used to connect up to two Cable Extension Units: up to four extension units, two channels x two units, can be connected by using two channels.

Connection Configuration

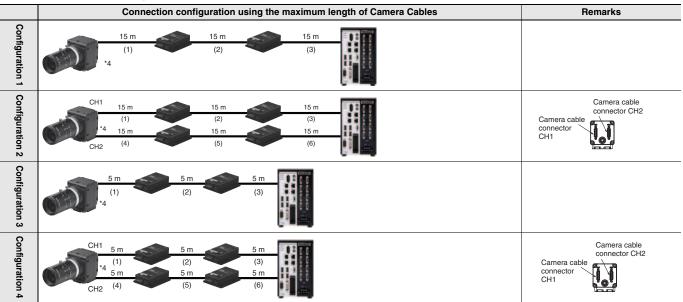

*4 Select the Camera Cables between the Controller and Extension Unit, between the Extension Units, and between the Extension Unit and Camera according to the connected Camera.

Different types or lengths of Camera Cables can be used for (1), (2), and (3) as well as for (4), (5), and (6). However, the type and length of Camera Cable (1) must be the same as those of Camera Cable (4), (2) must be the same as (5), and (3) must be the same as (6).

Touch Panel Monitor

Item	Descriptions	Model
	Touch Panel Monitor 12.1 inches For FH Sensor Controllers *	FH-MT12
EH Series Sensor C	controllers version 5.32 or higher is required	

* FH Series Sensor Controllers version 5.32 or higher is required.

Touch Panel Monitor Cables

Item	Descriptions	Model
4 9	DVI-Analog Conversion Cable for Touch Panel Monitor Cable length: 2 m, 5 m or 10 m	FH-VMDA 🗆 M *1
	RS-232C Cable for Touch Panel Monitor Cable length: 2 m, 5 m or 10 m	XW2Z-□□□PP-1 *2
, Ó,	USB Cable for Touch Panel Monitor Cable length: 2 m or 5 m	FH-VUAB 🗆 M *1

Insert the cables length into \Box in the model number as follows. 2 m = 2, 5 m = 5, 10 m = 10 *1

*2 Insert the cables length into $\Box \Box$ in the model number as follows. 2 m = 200, 5 m = 500, 10 m = 010.

A video signal cable and an operation signal cable are required to connect the Touch Panel Monitor.

Signal	Signal Cable		5 m	10 m
Video signal	DVI-Analog Conversion Cable	Yes	Yes	Yes
Touch panel operation	USB Cable	Yes	Yes	No
signal	RS-232C Cable	Yes	Yes	Yes

Parallel I/O Cables/Encoder Cable

Item	Descriptions	Model
- ?	Parallel I/O Cable *1 Cable length: 2m, 5m or 15m	XW2Z-S013- □ *2
	Parallel I/O Cable for Connector-terminal Conversion Unit *1 Cable length: 0.5 m, 1 m, 1.5 m, 2 m, 3 m, 5 m Connector-Terminal Block Conversion Units can be connected (Terminal Blocks Recommended Products: OMRON XW2R-□34G-T)	XW2Z-□□□EE *3
Real Property in the second	Connector-Terminal Block Conversion Units, General-purpose devices	XW2R-⊡34GD-T *4
∕ ○ ,	Encoder Cable for line-driver Cable length: 1.5 m	FH-VR 1.5M

2 Cables are required for all I/O signals.

*1 *2 *3 *4 Insert the cables length into \Box in the model number as follows. 2 m = 2, 5 m = 5, 15 m = 15 Insert the cables length into \Box in the model number as follows. 0.5 m = 0.50, 1 m = 100, 1.5 m = 150, 2 m = 200, 3 m = 300, 5 m = 500 Insert the wiring method into \Box in the model number as follows. Phillips screw = J, Slotted screw (rise up) = E, Push-in spring = P Refer to the XW2R Series catalog (Cat. No. G077) for details.

Parallel Converter Cable

When you change to connect the F series, FZ5 series, or FZ5-L series to FH series Sensor Controller, you can convert by using the appropriate parallel converter cable of FH-VPX series under the usable condition.

ltem	App	licable Model	Usable Condition	Model
	FZ⊡ series		 Do not use RESET signal. * Use with COMIN and COMUT are same power source. 	FH-VPX-FZ
	FZ□-L35x series		Do not use RESET signal. *	FH-VPX-FZL
	F160 series	F160-C10	 Do not use RESET signal. * Use with COMIN and COMOUT are same power source. Do not use DI5 and DI6. 	FH-VPX-F160
\frown	F210-C10		• Do not use RESET signal. *	
🖌 🏒	F210 series	F210-C10-ETN	Use with COMIN and COMOUT are same power source.	FH-VPX-F210
F500 series		F500-C10	Do not use DI8 and DI9.	

Even if RESET signal cannot be use by conversion, conversion is possible to convert satisfying other usable condition. Note: Cannot be used for the F160-C10CP/-C10CF.

Recommended EtherCAT and EtherNet/IP Communications Cables

Use Straight STP (shielded twisted-pair) cable of category 5 or higher with double shielding (braiding and aluminum foil tape) for EtherCAT. Use Straight or cross STP (shielded twisted-pair) cable of category 5 or higher for EtherNet/IP.

Item		Descriptio	Model		
				Cable length: 0.3 m	XS6W-6LSZH8SS30CM-Y
		Cable with Connectors on Both Ends (RJ45/	RJ45)	Cable length: 0.5 m	XS6W-6LSZH8SS50CM-Y
\bigcirc		Standard RJ45 plugs type *1 Wire Gauge and Number of Pairs: AWG26, 4	L naix Cabla	Cable length: 1 m	XS6W-6LSZH8SS100CM-V
		Cable Sheath material: LSZH *2	i-pair Cable	Cable length: 2 m	XS6W-6LSZH8SS200CM-V
*		Cable color: Yellow *3		Cable length: 3 m	XS6W-6LSZH8SS300CM-
				Cable length: 5 m	XS6W-6LSZH8SS500CM-1
				Cable length: 0.3 m	XS5W-T421-AMD-K
		Cable with Connectors on Both Ends (RJ45/	D 145)	Cable length: 0.5 m	XS5W-T421-BMD-K
15		Rugged RJ45 plugs type *1	nJ43)	Cable length: 1 m	XS5W-T421-CMD-K
*0		Wire Gauge and Number of Pairs: AWG22, 2	2-pair Cable	Cable length: 2 m	XS5W-T421-DMD-K
		Cable color: Light blue		Cable length: 5 m	XS5W-T421-GMD-K
				Cable length: 10 m	XS5W-T421-JMD-K
	FOR EUTERCAT	or EtherCAT		Cable length: 0.5 m	XS5W-T421-BM2-SS
		Cable with Connectors on Both Ends (M12 St	raight/M12 Straight)	Cable length: 1 m	XS5W-T421-CM2-SS
-		Shield Strengthening Connector cable *4 M12/Smartclick Connectors		Cable length: 2 m	XS5W-T421-DM2-SS
-0		Wire Gauge and Number of Pairs: AWG22, 2	2-pair Cable	Cable length: 3 m	XS5W-T421-EM2-SS
		Cable color: Black		Cable length: 5 m	XS5W-T421-GM2-SS
				Cable length: 10 m	XS5W-T421-JM2-SS
				Cable length: 0.5 m	XS5W-T421-BMC-SS
		Cable with Connectors on Both Ends (M12 S Shield Strengthening Connector cable *4	traight/RJ45)	Cable length: 1 m	XS5W-T421-CMC-SS
15		M12/Smartclick Connectors		Cable length: 2 m	XS5W-T421-DMC-SS
-0		Rugged RJ45 plugs type	a nair Cabla	Cable length: 3 m	XS5W-T421-EMC-SS
		Wire Gauge and Number of Pairs: AWG22, 2-pair Cable Cable color: Black		Cable length: 5 m	XS5W-T421-GMC-SS
				Cable length: 10 m	XS5W-T421-JMC-SS
-				Hitachi Metals, Ltd.	NETSTAR-C5E SAB 0.5 × 4P *5
		Wire Gauge and Number of Pairs: AWG24, 4-pair Cable	Cables	Kuramo Electric Co.	KETH-SB *5
	For EtherCAT	Pairs: AWG24, 4-pair Cable		SWCC Showa Cable Systems Co.	FAE-5004 *5
	and EtherNet/IP		RJ45 Connectors	Panduit Corporation	MPS588-C *5
			Cables	Kuramo Electric Co.	KETH-PSB-OMR *6
		Wire Gauge and Number of	Cables	JMACS Japan Co.,Ltd.	PNET/B *6
		Pairs: AWG22, 2-pair Cable RJ45 Conr		OMRON	XS6G-T421-1 *6
		Wire Gauge and Number of	Cables	Fujikura Ltd.	F-LINK-E 0.5mm × 4P *7
	For EtherNet/IP	Pairs: 0.5 mm, 4-pair Cable	RJ45 Connectors	Panduit Corporation	MPS588 *7

Note: Please be careful while cable processing, for EtherCAT, connectors on both ends should be shield connected and for EtherNet/IP, connectors on only one end should be te: Please be careful while cable processing, for EtherCAT, connectors on both ends should be shield connected and for EtherNet/IP, connectors on only one end should be shield connected.
Standard type cables length 0.2, 0.3, 0.5, 1, 1.5, 2, 3, 5, 7.5, 10, 15 and 20 m are available.
Rugged type cables length 0.3, 0.5, 1, 2, 3, 5, 10 and 15 m are available.
For details, refer to Cat.No.G019.
The lineup features Low Smoke Zero Halogen cables for in-cabinet use and PUR cables for out-of-cabinet use. Although the LSZH cable is single shielded, its communications and noise characteristics meet the standards.
Cables colors are available in blue, yellow, or Green.
For details, contact your OMRON representative.
We recommend you to use above cable for EtherCAT and EtherNet/IP, and RJ45 Connector together.
We recommend you to use above cable for EtherCAT and EtherNet/IP, and RJ45 Assembly Connector together.
We recommend you to use above cable for EtherCAT and EtherNet/IP and RJ45 Connector together. *1

*2

*3 *4 *5 *6 *7

Automation Software Sysmac Studio Please purchase a DVD and licenses the first time you purchase the Sysmac Studio. DVDs and licenses are available individually. The license does not include the DVD.

Item	Creatifications			Model	
nem	Specifications	Number of licenses	Media	woder	
	The Sysmac Studio is the software that provides an integrated	(Media only)	DVD *1	SYSMAC-SE200D	
	environment for setting, programming, debugging and maintenance of machine automation controllers including the NJ/NX-series CPU	1 license	-	SYSMAC-SE201L	
	Units, NY-series Industrial PC, EtherCat Slave, and the HMI.	3 license	-	SYSMAC-SE203L	
Sysmac Studio	Windows 7 (32-bit/64-bit version) /	10 license	-	SYSMAC-SE210L	
Standard Edition		30 license	-	SYSMAC-SE230L	
Ver.1.	Windows 8.1 (32-bit/64-bit version) / Windows 10 (32bit/64bit version) This software provides functions of the Vision Edition. Refer to Sysmac Catalog (P072) for details such as supported models and functions.	50 license	_	SYSMAC-SE250L	
Sysmac Studio Vision Edition Ver.1	Sysmac Studio Vision Edition is a limited license that provides selected functions required for FH-serise/ FQ-M-series Vision Sensor settings.	1 license	_	SYSMAC-VE001L	
Sysmac Studio Robot Additional Option *3	Sysmac Studio Robot Additional Option is a license to enable the Vision & Robot integrated simulation.	1 license	_	SYSMAC-RA401L	

Note: 1. Site licenses are available for users who will run Sysmac Studio on multiple computers. Ask your OMRON sales representative for details.
 2. Sysmac Studio version 1.07 or higher supports the FH Series. Sysmac Studio does not support the FH-L550/-L550-10.

*1 *2 *3

The same media is used for both the Standard Edition and the Vision Edition. With the Vision Edition, you can use only the setup functions for FH-series/FQ-M-series Vision Sensors. This product is a license only. You need the Sysmac Studio Standard Edition DVD media to install it.

Development Environment

Please purchase a CD-ROM and licenses the first time you purchase the Application Producer. CD-ROMs and licenses are available individually. The license does not include the CD-ROM.

Product	Specifications	Number of Model Standards licenses	Media	Model
	 Software components that provide a development environment to further customize the standard controller features of the FH Series. System requirements: CPU: Intel Pentium Processor (SSE2 or higher) OS: Windows 7 Professional (32/64bit) or Enterprise(32/64bit), Windows 8 Pro(32/64bit), The Enterprise(32/64bit), 	— (Media only)	CD-ROM	FH-AP1
Application Producer	Windows 8.1 Pro(32/64bit) or Enterprise(32/64bit) • .NET Framework: .NET Framework 3.5 or higher • Memory: At least 2 GB RAM Available disk space: At least 2 GB • Browser: Microsoft® Internet Explorer 6.0 or later • Display: XGA (1024 × 768), True Color (32-bit) or higher • Optical drive: CD/DVD drive The following software is required to customize the software: Microsoft® Visual Studio® 2010 Professional or Microsoft® Visual Studio® 2012 Professional or Microsoft® Visual Studio® 2012 Professional	1 license	_	FH-AP1L

FH-Series

Item		D	escriptions		Model
	LCD Monitor 8.4 inches				FZ-M08
	LCD Monitor Cable			2 m	FZ-VM 2M
.0			H sensor controller, please use it	5 m	FZ-VM 5M
	DVI-I -RGB Conversion Co	onnector			FH-VMRGB
	USB Memory		2 GB 8 GB		FZ-MEM2G FZ-MEM8G
	SD Card		2 GB		HMC-SD291
200			4 GB		HMC-SD491
	Display/USB Switcher				FZ-DU
- 1	Mouse Recommended Pro Driverless wired mouse (A mouse that requires the		installed is not supported.)		
	ι · ·	3 port	Power supply voltage:	Current consumption: 0.08 A	GX-JC03
	EtherCAT junction slaves	6 port	20.4 to 28.8 VDC (24 VDC -15 to 20%)	Current consumption:	
E		6 port		0.17 A	GX-JC06
	Industrial Switching Hubs	3 port	Failure detection: None	Current consumption: 0.08 A	W4S1-03B
	for EtherNet/IP and Ether- net	5 port	Failure detection: None	Current consumption:	W4S1-05B
2	Calibration Plate	5 port	Failure detection: Supported	0.12 A	W4S1-05C
-	Calibration Plate				FZD-CAL
Ш.Л		DIN rail mounting b	racket		FH-XDM-L
	Common items related to DIN rail	DIN 35mm rail	PHOENIX CONTACT	 Length: 75.5/95.5/ 115.5/200 cm Height: 7.5mm Material: Iron Surface: Conductive 	NS 35/7,5 PERF
	(for FH-L550/-L550-10)			 Length:75.5/95.5/ 115.5/200 cm Height: 15mm Material: Iron Surface: Conductive 	NS 35/15 PERF
05		End plate	PHOENIX CONTACT	Need 2 pieces each Sensor Controller	CLIPFIX 35
- 1	External Lighting				FLV Series * FL Series *
			For FLV-Series	Camera Mount Light- ing Controller	FLV-TCC Series
	Lighting Controller (Required to control external lighting from a Co	ntroller)		Analog Lighting Con- troller	FLV-ATC Series *
7			For FL-Series	Camera Mount Light- ing Controller	FL-TCC Series *
				Mounting Bracket	FQ-XL
	For Intelligent Compact Dig	gital CMOS Camera		Mounting Brackets	FQ-XL2
				Polarizing Filter At- tachment	FQ-XF1
	Mounting Bracket for FZ-S			1	FZ-S-XLC
	Mounting Bracket for FZ-S		FZ-S2M-XLC		
	Mounting Bracket for FZ-S Mounting Bracket for FH-S		FZ-SH-XLC FH-SM-XLC		
	Mounting Bracket for FH-S				FH-SM12-XLC
	M42 - F Mount Conversion				FH-ADF/M42-10

* Refer to the Vision Accessory Catalog (Cat. No. Q198) for details.

Lenses C-mount Lens for 1/3-inch image sensor (Recommend: FZ-S□/FZ-SH□/FH-S□)

			•	•				,			
Model	3Z4S-LE SV-03514V	3Z4S-LE SV-04514V	3Z4S-LE SV-0614V	3Z4S-LE SV-0813V	3Z4S-LE SV-1214V	3Z4S-LE SV-1614V	3Z4S-LE SV-2514V	3Z4S-LE SV-3518V	3Z4S-LE SV-5018V	3Z4S-LE SV-7527V	3Z4S-LE SV-10035V
Appearance/ Dimensions (mm)	29.5 dia 30.4	29.5 dia 29.5	29 dia. 30.0	28 dia.	29 dia. 29.5	29 dia. 24.0	29 dia. 24.5	29 dia. 33.5[WD:∞] to 37.5[WD:300]	32 dia. 37.0[WD:∞] to 39.4[WD:1000]	32 dia. 42.0[WD:∞] to 44.4[WD:1000]	32 dia. 43.9[WD:∞] to 46.3[WD:1000]
Focal length	3.5 mm	4.5 mm	6 mm	8 mm	12 mm	16 mm	25 mm	35 mm	50 mm	75 mm	100 mm
Aperture (F No.)	1.4 to Close	1.4 to Close	1.4 to Close	1.3 to Close	1.4 to Close	1.4 to Close	1.4 to Close	1.8 to Close	1.8 to Close	2.7 to Close	3.5 to Close
Filter size	-	_	M27.0 P0.5	M25.5 P0.5	M27.0 P0.5	M27.0 P0.5	M27.0 P0.5	M27.0 P0.5	M30.5 P0.5	M30.5 P0.5	M30.5 P0.5
Maximum sensor size	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch	1/3 inch
Mount							C mount	•			

C-mount Lens for 2/3-inch image sensor (Recommend: FZ-S□2M/FZ-S□5M2/FH-S□05R) (3Z4S-LE SV-7525H and 3Z4S-LE SV-10028H can also be used for FH-S□02 and FH-S□04)

sensor size	2/3 inch	2/3 inch	2/3 inch	2/3 inch	2/3 inch C moun	2/3 inch	2/3 inch	1 inch	1 inch
Filter size Maximum	M40.5 P0.5	M35.5 P0.5	M27.0 P0.5	M27.0 P0.5	M27.0 P0.5	M35.5 P0.5	M40.5 P0.5	M34.0 P0.5	M37.5 P0.5
Aperture (F No.)	1.4 to 16	2.5 to Close	2.8 to Close						
Focal length	6 mm	8 mm	12 mm	16 mm	25 mm	35 mm	50 mm	75 mm	100 mm
Appearance/ Dimensions (mm)	42 dia. 57.5	39 dia. 52.5	30 dia. 51.0	30 dia. 47.5	30 dia. 36.0	44 dia. 45.5	44 dia. 57.5	36 dia. ↓49.5[WD:∞] to 54.6[WD:1200]	39 dia. 66.5[WD:x] to 71.6[WD:2000]
Model	3Z4S-LE SV-0614H	3Z4S-LE SV-0814H	3Z4S-LE SV-1214H	3Z4S-LE SV-1614H	3Z4S-LE SV-2514H	3Z4S-LE SV-3514H	3Z4S-LE SV-5014H	3Z4S-LE SV-7525H	3Z4S-LE SV-10028H

C-mount Lens for 1-inch image sensor (Recommend: FH-SD02/FH-SD04) (3Z4S-LE SV-7525H with focal length of 75 mm and 3Z4S-LE SV-10028H with focal length of 100 mm are also available.)

Model	3Z4S-LE VS-0618H1	3Z4S-LE VS-0814H1	3Z4S-LE VS-1214H1	3Z4S-LE VS-1614H1N	3Z4S-LE VS-2514H1	3Z4S-LE VS-3514H1	3Z4S-LE VS-5018H1
Appearance/ Dimensions (mm)	64.5 dia. 57.2	57 dia. 59	38 dia	38 dia. 45.0[WD:x] to 45.9[WD:300]	38 dia. 33.5[WD:∞] to 35.6[WD:300]	38 dia. 35.0[WD:∞] to 39.1[WD:300]	44 dia. 44.5[WD:∞] to 49.5[WD:500]
Focal length	6 mm	8 mm	12 mm	16 mm	25 mm	35 mm	50 mm
Aperture (F No.)	1.8 to 16	1.4 to 16	1.4 to 16	1.4 to 16	1.4 to 16	1.4 to 16	1.8 to 16
Filter size	Can not be used a filter	M55.0 P0.75	M35.5 P0.5	M30.5 P0.5	M30.5 P0.5	M30.5 P0.5	M40.5 P0.5
Maximum sensor size	1 inch	1 inch	1 inch	1 inch	1 inch	1 inch	1 inch
Mount				C mount			

M42-mount Lens for large image sensor (Recommend: FH-S□12)

Model	3Z4S-LE VS-L1828/M42-10	3Z4S-LE VS-L2526/M42-10	3Z4S-LE VS-L3528/M42-10	3Z4S-LE VS-L5028/M42-10	3Z4S-LE VS-L8540/M42-10	3Z4S-LE VS-L10028/M42-10
Appearance/ Dimensions (mm)	58.5 dia. 94	58.5 dia. 80	64.5 dia. 108	66 dia. 94.5	55.5 dia. 129.5	54 dia. 134.5
Focal length	18 mm	25 mm	35 mm	50 mm	85 mm	100 mm
Aperture (F No.)	2.8 to 16	2.6 to 16	2.8 to 16	2.8 to 16	4.0 to 16	2.8 to 16
Filter size	M55.0 P0.75	M55.0 P0.75	M62.0 P0.75	M62.0 P0.75	M52.0 P0.75	M52.0 P0.75
Maximum sensor size			1.8	inch		
Mount			M42 r	mount		

Lenses for small camera

Model	FZ-LES3	FZ-LES6	FZ-LES16	FZ-LES30
Appearance/ Dimensions (mm)	12 dia.	12 dia. 19.7	12 dia. 23.1	12 dia.
Focal length	3 mm	6 mm	16 mm	30 mm
Aperture (F No.)	2.0 to 16	2.0 to 16	3.4 to 16	3.4 to 16

Vibrations and Shocks Resistant C-mount Lens for 2/3-inch image sensor (Recommend: FZ-S□/FZ-S□2M/FZ-S□5M2/FZ-SH□/FH-S□/FH-S□05R)

(Vibrations and Shocks Resistant Lenses for 1-inch image sensors and for large image sensors are also available. Ask your OMRON representative for details.)

Model				3Z VS-MC1	24S-LE 5-000	* 1				3Z4S-LE VS-MC20								
Appearance/ Dimensions (mm)				31 dia.	4[0.03×] to 2	29.5[0.3×]							31 dia. 23.	0[0.04×] to	30.5[0.4×]			
Focal length		15 mm											2	0 mm				
Filter size				M2	7.0 P0.	5				M27.0 P0.5								
Optical magnification	C).03 ×			0.2×		().3×		$0.04 \times$ $0.25 \times$ $0.4 \times$								
Aperture (fixed F No.) *2	2	5.6	8	2	5.6	8	2	5.6	8	2	5.6	8	2	5.6	8	2	5.6	8
Depth of field (mm) *3	183.1	3.1 512.7 732.4 4.8 13.4 19.2 2.3 6.5						9.2	110.8	291.2	416.0	3.4	9.0	12.8	1.5	3.9	5.6	
Maximum sensor size								2/3	inch									
Mount									СМ	ount								

Model			١	3Z S-MC25/	4S-LE N-DDD								3Z VS-MC3	24S-LE				
Appearance/ Dimensions (mm)				31 dia. 26	5[0.05×] to	38.0[0.5×]						:	31 dia. 24.0)[0.06×] to 3	5.7[0.45×]			
Focal length		25 mm											3	0 mm				
Filter size				M27	7.0 P0.	5			M27.0 P0.5									
Optical magnification	C	$0.05 \times$		0	.25 ×			0.5×		().06 ×		C).15 ×		().45 ×	
Aperture (fixed F No.) *2	2	5.6	8	2	5.6	8	2	5.6	8	2	5.6	8	2	5.6	8	2	5.6	8
Depth of field (mm) *3	67.2	7.2 188.2 268.8 3.2 9.0 12.8 1.0 2.7 3						3.8	47.1	131.9	188.4	8.2	22.9	32.7	1.1	3.2	4.6	
Maximum sensor size									2/3 i	inch		•					•	
Mount										CMount								

Model				3Z VS-MC3	4S-LE 5-000	□□ *1							32 VS-MC5	Z4S-LE 0-	□□ *1			
Appearance/ Dimensions (mm)				31 dia.) [0.26×] to 4	15.7[0.65×]							31 dia. 44	4.5[0.08×] to	63.9[0.48×]			
Focal length		35 mm											5	50 mm				
Filter size				M27	7.0 P0.	5			M27.0 P0.5									
Optical magnification	0	.26 ×		().3×		C).65 ×		C).08 ×			0.2 ×		C).48 ×	
Aperture (fixed F No.) *2	1.9	5.6	8	1.9	5.6	8	1.9	5.6	8	2	5.6	8	2	5.6	8	2	5.6	8
Depth of field (mm) *3	2.8	.8 8.4 11.9 2.2 6.5 9.2 0.6 1.7							2.5	33.8	75.6	108.0	6.0	13.4	19.2	1.3	2.9	4.1
Maximum sensor size									2/3	inch							·	
Mount										ount								

Model				3Z VS-MC75	4S-LE 5-000	□□ *1								
Appearance/ Dimensions (mm)				31 dia. 70.0[). 14×] to 10	15.5[0.62×]								
Focal length		75 mm												
Filter size				M27	7.0 P0.	5								
Optical magnification	0	.14 ×		().2×		0	.62×						
Aperture (fixed F No.) *2	3.8	5.6	8	3.8	5.6	8	3.8	5.6	8					
Depth of field (mm) *3	17.7	26.1	37.2	9.1	13.4	19.2	1.3	1.9	2.7					
Maximum sensor size	2/3 inch													
Mount		C Mount												

*1 Insert the aperture into □□□□ in the model number as follows. F=1.9 to 3.8: blank F=5.6: FN056 F=8: FN080
*2 F-number can be selected from maximum aperture, 5.6, and 8.0.
*3 When circle of least confusion is 40 µm.

High-resolution Telecentric Lens for C-mount Lens for 2/3-inch image sensor (Recommend: FZ-S□/FZ-SH□/FZ-S□2M/FZ-S□5M2/FH-S□/FH-S□05R)



Model *	1		3Z4S-LE VS-TCH05 -65	3Z4S-LE VS-TCH05 -110	3Z4S-LE VS-TCH1 -65	3Z4S-LE VS-TCH1 -110	3Z4S-LE VS-TCH1.5 -65	3Z4S-LE VS-TCH1.5 -110	3Z4S-LE VS-TCH2 -65	3Z4S-LE VS-TCH2 -110	3Z4S-LE VS-TCH4 -65	3Z4S-LE VS-TCH4 -110
Optical (±5%)	magnificatio	on	0.5x		1.0x		1.5x		2.0x		4.0x	
	FH-SC/- SM	1/3 inch equivalent	9.6×7.2		4.8×3.6		3.2×2.4		2.4×1.8		1.2×0.9	
Field of	FH-S□05R	1/2.5 inch equivalent	11.4×8.56		5.7×4.28		3.8×2.85		2.85×2.14		1.43×1.07	
view	FZ-SC/-S	1/3 inch equivalent	9.6×7.2		4.8×3.6		3.2×2.4		2.4×1.8		1.2×0.9	
(±5%) (VxH) (mm)	FZ-SC2M /xH) / S2M 1/1.8 inch equivalent				7.0×5.3		4.7×3.5		3.5×2.7		1.8×1.3	
()	FZ-SC5M□ /-S5M□	2/3 inch equivalent	16.8×14.2		8.4×7.1		5.6×4.7		4.2×3.6		2.1×1.8	
WD(mm	n) *2		75.3	110.8	68.8	110.3	65	110.8	65	110.8	65	110.8
Effectiv	e FNO		9.42	9.49	9.94	10.49	11.8	11.97	13.6	13.5	17.91	22.2
Depth o	epth of field (mm) *3			3.04	0.8	0.84	0.4	0.43	0.3	0.27	0.09	0.11
Resolut	esolution *4			12.9	6.71	6.99	5.24	5.33	4.53	4.53	3	3.73
TV dist	V distortion			0.02%	0.01%	0.02%	0.01% 0.02%		0.03% 0.03%		0.02%	0.03%
Maximu	ım sensor si	ze	2/3 inch		2/3 inch		2/3 inch		2/3 inch		2/3 inch	

*1 Insert the shape into a low in the model number as follows.

Straight : -O Coaxial : CO-O

*2 The working distance is the distance from the end of the lens to the sensor.

*3 The depth of field is calculated using a permissible circle of confusion diameter of 0.04 mm.

*4 The resolution is calculated using a wavelength of 550 nm.

Note: 1. Fixing the lens or other reinforcement may be required depending on the installation angle or operating environment (vibration/shock). When fixing the lens, insulate the lens from the fixture.

2. The above specifications are values calculated from the optical design and can vary depending on installation conditions.

Extension Tubes

Lenses	For M42 mount Lenses *	For C mount Lenses *	For Small Digital CCD Cameras FZ-LESR		
Model	3Z4S-LE VS-EXR/M42	3Z4S-LE SV-EXR			
Contents	Set of 5 tubes (20 mm, 10 mm, 8 mm, 2 mm, and 1 mm) Maximum outer diameter: 47.5 mm dia.	Set of 7 tubes (40 mm, 20 mm,10 mm, 5 mm, 2.0 mm, 1.0 mm, and 0.5 mm) Maximum outer diameter: 30 mm dia.	Set of 3 tubes (15 mm,10 mm, 5 mm) Maximum outer diameter: 12 mm dia.		

Do not use the 0.5-mm, 1.0-mm, and 2.0-mm Extension Tubes attached to each other. Since these Extension Tubes are placed over the threaded section of the Lens or other Extension Tube, the connection may loosen when more than one 0.5-mm, 1.0-mm or 2.0-mm Extension Tube are used together. Reinforcement is required to protect against vibration when Extension Tubes exceeding 30 mm are used. When using the Extension Tube, check it on the actual device before using it.

FH-Series

Ratings and Specifications (FH Sensor Controllers)

High-speed Controllers/Standard Controllers

Sensor Controlle			Hir	FH-3000 series gh-speed Controller		FH-1000 series Standard Controller (2 cores)					
antualla. T	ype ensor Controller Model		FH-3050	FH-3050-10	FH-3050-20	FH-1050 FH-1050-10 FH-1050-20					
Controller Type		BOX type									
arallel IO	1		NPN/PNP (common)								
		Standard	Yes								
	Operation	Double Speed Multi-input									
	Mode	Non-stop adjustment mode									
	Parallel Proce	Multi-line random-trigger mode									
			2	4	8	2	4	8			
	Number of Connectable Camera			-	All of the FH-S			All of the FH-S			
	Supported	FH-S series camera	All of the FH-S series cameras series can		series cameras	All of the FH-S series are connectable.	s cameras	series cameras			
lain	Camera				are connectable. *1	are connectable.		are connectable.			
unctions	Camera I/F	FZ-S series camera	All of the FZ-S series cameras are connectable. OMRON I/F								
		har of Capturad Imagos									
	Possible Number of Captured Images Possible Number of Logging Images to Sensor Controller		Refer to page 36.								
	Possible Num	ber of Scenes	128								
	Operating	USB Mouse	Yes (wired USB and o	driver is unnecessary	type)						
	on UI	Touch Panel	Yes (RS-232C/USB c	,							
	Setup			g flow using Flow editi	-						
	Language			implified Chinese, Tra	aditional Chinese, Korean,	German, French, Spanisl	n, Italian				
	Serial Commu		RS-232C × 1								
	Ethernet	Protocol	Non-procedure (TCP/	1							
	Communication	I/F	1000BASE-T × 1	1000BASE-T × 2		1000BASE-T × 1	1000BASE-T × 2				
	EtherNet/IP Co		Ethernet port (transmi	ission rate: 1Gbps)							
	EtherCAT Cor	nmunication	Yes (slave)								
			 12 inputs/31 outputs Use 1 Line. 	3:							
				Except Multi-line rand	dom-trigger mode.						
			 17 inputs/37 outputs 								
			Use 2 Lines.								
xternal	Parallel I/O			Multi-line random-trig	iger mode.						
terface				• 14 inputs/29 outputs:							
			Use 3 to 4 Lines. Operation mode: Multi-line random-trigger mode.								
			 19 inputs/34 outputs 	s:							
			Use 5 to 8 Lines.								
				Multi-line random-trig	ger mode.						
	Encoder Interface		Input voltage: 5 V ± 5 Signal: BS-422A Line								
			Signal: RS-422A LineDriver Level Phase A/B/Z: 1 MHz								
	Monitor Interfa	ace	DVI-I output (Analog RGB & DVI-D single link) × 1								
	USB I/F		USB2.0 host × 4 (BUS	S Power: Port5 V/0.5	A)						
	SD Card I/F		SDHC × 1								
			POWER: Green								
	Main		ERROR: Red RUN: Green								
			ACCESS: Yellow								
			NET RUN: Green	NET RUN1: Green		NET RUN: Green	NET RUN1: Green	allau			
ndicator	Ethernet		NET LINK NET LINK AGAT: Yellow NET LINK NET LINK AGAT: Yellow								
amps			ACT: Yellow NET RUN2: Green ACT: Yellow NET LINK ACK2: Yellow NET LINK ACK2: Yellow								
•	SD Card		SD POWER: Green								
	ob ouru		SD BUSY: Yellow								
			EtherCAT RUN LED: Green EtherCAT LINK/ACT IN LED: Green								
	EtherCAT		EtherCAT LINK/ACT OUT LED: Green								
			EtherCAT ERR LED:								
ower-supply vo	oltage		20.4 VDC to 26.4 VDC			1					
	When con-	Connected to 2 cameras	5.0 A max.	5.4 A max.	6.4 A max.	4.7 A max.	5.0 A max.	5.9 A max.			
	nected to	Connected to 4 cameras		7.0 A max.	8.1 A max.		6.5 A max.	7.5 A max.			
urrent onsumption	a Controller	Connected to 8 cameras			11.5 A max.			10.9 A max.			
onsumption	When not	Connected to 2 cameras	4.1 A max.	4.2 A max.	5.2 A max.	3.6 A max.	3.7 A max.	4.5 A max.			
	connected Connected to 4 cameras			4.8 A max.	5.6 A max.		4.3 A max.	5.0 A max.			
uilt-in FAN	to controller	Connected to 8 cameras	 Yes		6.8 A max.			6.2 A max.			
unt-III FAN	1		Yes Operating: 0°C to 50°	2							
	Ambient temp	erature range	Storage: -20 to +65°C (with no icing or condensation)								
	Ambient humi	dity range	Operating:35 to 85%RH								
		, ,	Storage: 35 to 85%RH (with no condensation)								
	Ambient atmo	sphere	No corrosive gases								
			Oscillation frequency: 10 to 150 Hz								
			Half amplitude: 0.1 mm Acceleration: 15 m/s ²								
	Vibration tole	ance	Sweep time: 8 minute/count								
Isage			Sweep count: 10								
Invironment			Vibration direction: up and down/front and behind/left and right Impact force: 150 m/s ²								
	Shock resistance		Test direction: up and								
	SHOCK RESISTANCE		behind/left and right								
				DC power							
	Noise	Foot Transient	Direct infusion: 2kV, Pulse rising: 5ns, Pulse width: 50ns,								
	Noise immunity	Fast Transient Burst	Burst continuation time: 15ms/0.75ms, Period: 300ms, Application time: 1 min I/O line								
	immunity Burst Grounding		Direct infusion: 1kV, Pulse rising: 5ns, Pulse width: 50ns,								
			Burst continuation time: 15ms/0.75ms, Period: 300ms, Application time: 1 min								
			Type D grounding (100 Ω or less grounding resistance) *2								
	Dimensions		190 mm × 115 mm ×								
						Approx 0.0 br	Anney 0.4 br	Anne: 0.41			
	Malaki	Weight		Note Height: Including the rubber feet at the base. Approx. 3.2 kg Approx. 3.4 kg Approx. 3.2 kg Approx. 3.4 kg Approx. 3.2 kg							
	-	testion		IEC60529 IP20							
xternal eatures	Weight Degree of pro	tection	IEC60529 IP20								
	-	tection	IEC60529 IP20 Cover: zinc-plated ste								
	Degree of pro	lection	IEC60529 IP20 Cover: zinc-plated ste Side plate: aluminum	(A6063)	1, Instruction Installation M uctions for EU:1, Power so	anual for FH series:1					

*1 When the 12 megapixels camera: Max. 4 cameras are connectable. When use except 12 megapixels cameras: Max. 8 cameras are connectable.
 *2 Existing third class grounding

Lite Controllers

Sensor Controller Series			FH-L series						
Type			Lite Controller						
Sensor Controller Model			FH-L550	FH-L550-10					
Controller Type			BOX type						
Parallel IO			NPN/PNP (common)						
		Standard	Yes						
		Double Speed Multi-input	Yes						
	Operation	Non-stop adjustment	Yes						
	Mode	mode							
		Multi-line random-trigger	No						
		mode							
	Parallel Processing		Yes						
	Number of Connectable Camera		2	4					
	Supported	FH-S series camera	All of the FH-S series cameras are connectable						
Main Func-	Camera	FZ-S series camera	All of the FZ-S series cameras are connectable.						
10115	Camera I/F		OMRON I/F						
	Possible Num	ber of Captured Images							
	Possible Num	ber of Logging Images to	Refer to page 36.						
	Sensor Contro	oller							
	Possible Num	ber of Scenes	128						
	UI Opera-	USB Mouse	Yes (wired USB driver-less type)						
	tions	Touch Panel	Yes (RS-232C/USB connection: FH-MT12)						
	Setup		Create the processing flow using Flow editing.						
	Language		Japanese, English, Simplified Chinese, Traditional Chinese, Korean, Ge	rman French Spanish Italian					
	Serial Commu	inication	RS-232C × 1	man, control, opanion, italian					
	Ethernet								
	Ethernet Communica-	Protocol	Non-procedure (TCP/UDP)						
	tion	I/F	1000BASE-T × 1						
	EtherNet/IP Co	ommunication	Ethernet port (transmission rate: 1 Gbps)						
	EtherCAT Cor								
	EllierCAT CO	munication	No						
External			High-speed input: 1 Normal apaced: 9						
Interface Parallel I/O			Normal speed: 9 High-speed output: 4						
			Normal speed: 23						
	Encoder Inter	face	None						
	Monitor Interfa	ace	DVI-I output (Analog RGB & DVI-D single link) × 1						
			USB2.0 host × 1: BUS Power: Port 5 V/0.5 A						
	USB I/F		USB3.0 × 1: BUS Power: Port 5 V/0.5 A						
	SD Card I/F		SDHC × 1						
			POWER: Green						
	Main		ERROR: Red						
			RUN: Green ACCESS: Yellow						
Indicator									
Lamps	Ethernet		NET RUN: Green						
Lumpo			NET LINK ACT: Yellow						
	SD Card		SD POWER: Green SD BUSY: Yellow						
	EtherCAT		Solo Solo Solo Solo Solo Solo Solo Solo						
	1								
Power-supply v	1		20.4 VDC to 26.4 VDC						
	When con-	Connected to 2 cameras	3.5 A max.	3.7 A max.					
	nected to a	Connected to 4 cameras		5.9 A max.					
Current	Controller	Connected to 8 cameras							
consumption	When not	Connected to 2 cameras	1.5 A max.	1.7 A max.					
	connected	Connected to 4 cameras		2.0 A max.					
	to Controller	Connected to 8 cameras							
Built-in FAN	1		No	1					
			Operating: 0°C to 55°C						
	Ambient temp	erature range	Storage: -25 to +70°C						
	Ambient humi	dity range	Operating and Storage: 10 to 90%RH (with no condensation)						
	Ambient atmo		No corrosive gases						
		·		n of 9.8 m/s ²					
	Vibration tole	rance	5 to 8.4 Hz with 3.5 mm amplitude, 8.4 to 150 Hz, acceleration of 9.8 m/s ² 100 min each in X, Y, and Z directions (10 sweeps of 10 min each = 100 min total)						
Jsage Envi-	a		Impact force: 150 m/s ²						
ronment	Shock resista	nce	Test direction: up and down/front and behind/left and right						
			DC power						
			Direct infusion: 2kV, Pulse rising: 5ns, Pulse width: 50ns,						
	Noise	Fast Transient Burst	Burst continuation time: 15ms/0.75ms, Period: 300ms, Application time: 1 min						
	immunity		 I/O line Direct infusion: 1kV, Pulse rising: 5ns, Pulse width: 50ns, 						
			Direct infusion: 1kV, Pulse rising: 5ns, Pulse width: 50ns, Burst continuation time: 15ms/0.75ms, Period: 300ms, Application time: 1 min						
	Grounding								
	Grounding		Type D grounding (100 Ω or less grounding resistance) *						
	Dimensions		200 mm × 80 mm × 130 mm						
xternal	Weight		Approx. 1.5 kg	Approx. 1.5 kg					
eatures	Degree of pro		IEC60529 IP20						
	Case material	s	PC						
			Instruction Sheet (Japanese and English): 1, Instruction Installation Man	ual for FH-L series:1,					
			General Compliance Information and Instructions for EU:1,						
Accessories			Power source(FH-XCN-L):1 (male)						

* Existing third class grounding

FH-Series

Number of logged images/Max. Number of Loading Images during Multi-input

	Color/ Monochrome	Model		Max. Number of							
			Connected to 1 camera	Connected to 2 camera	Connected to 3 camera	Connected to 4 camera	Connected to 5 camera	Connected to 6 camera	Connected to 7 camera	Connected to 8 camera	Loading Images during Multi-input *2
Intelligent Compact Digital CMOS Cameras *3	Color	FZ-SQ010F/-SQ050F/ -SQ100F/-SQ100N	232	116	77	58	46	38	33	29	
000 000 minute	Monochrome	FZ-S/-SF/-SH/-SP	272	136	90	68	54	45	38	34	256
300,000 pixels CCD Cameras	Color	FZ-SC/-SFC/-SHC/ -SPC	270	135	90	67	54	45	38	33	
300,000 pixels CMOS	Monochrome	FH-SM	272	136	90	68	54	45	38	34	256
Cameras	Color	FH-SC	270	135	90	67	54	45	38	33	200
2 million pixels CMOS Cameras	Color/ Monochrome	FH-SC02/-SM02	37	18	12	9	7	6	5	4	51
2 million pixels CCD Cameras	Color/ Monochrome	FZ-SC2M/-S2M	43	21	14	10	8	7	6	5	64
4 million pixels CMOS Cameras	Color/ Monochrome	FH-SC04/-SM04	20	10	6	5	4	3	2	2	32
5 million pixels CCD Cameras	Color/ Monochrome	FZ-SC5M2/-S5M2	16	8	5	4	3	2	2	2	25
5 million pixels Digital CMOS Cameras	Color/ Monochrome	FH-SC05R/-SM05R	16	8	5	4	3	2	2	2	25
12 million pixels CMOS Cameras	Color/Mono- chrome	FH-SC12/-SM12	6	3	2	2					10

Number of logging images is the maximum number of logging images that can be saved in the memory of the Sensor Controller itself and it depends on the settings of the system and the scene. Refer to Vision System FH/FZ5 Series User's Manual (Z340).
 When using two camera cables for connection, the maximum number of loaded images during multi-input is twice the number given in the table.
 The multi-input function cannot be used when the built-in lighting of an intelligent compact Digital camera is used.
 Refer to the Vision System FH/FZ5 Series User's Manual (Cat. No. Z340) for details.

Ratings and Specifications (Cameras)

High-speed Digital CMOS cameras

Model	FH-SM	FH-SC	FH-SM02	FH-SC02	FH-SM04	FH-SC04	FH-SM12	FH-SC12	
Image elements	CMOS image elements (1/3-inch equivalent)		CMOS image elements (2/3-inch equivalent)		CMOS image elements (1-inch equivalent)		CMOS image elements (1.76-inch equivalent)		
Color/Monochrome	Monochrome	Color	Monochrome	Color	Monochrome	Color	Monochrome	Color	
Effective pixels	640 (H) × 480 (V)		2040 (H) × 1088	2040 (H) × 1088 (V)		2040 (H) × 2048 (V)		4084 (H) × 3072 (V)	
Imaging area H x V (opposing corner)	4.8 × 3.6 (6.0 mm)		11.26 × 5.98 (12.76 mm)		11.26 × 11.26 (15.93 mm)		22.5 × 16.9 (28.14 mm)		
Pixel size	7.4 (μ m) $ imes$ 7.4 (μ	um)	5.5 (μ m) $ imes$ 5.5 (μ	μm)	5.5 (μ m) $ imes$ 5.5 (μ	um)	5.5 (μm) × 5.5 (μm)		
Shutter function	Electronic shutter Shutter speeds ca µs to 100 ms.		Electronic shutter; Shutter speeds can be set from 25 μs to 100 ms.				Electronic shutter; Shutter speeds can be set from 60 µs to 100 ms.		
Partial function	1 to 480 lines	2 to 480 lines	1 to 1088 lines 2 to 1088 lines 1 to 2048 lines 2 to 2048 lines		4 to 3072 lines (4-line increments)				
Frame rate (Image Acquisition Time)	308 fps (3.3 ms))	219 fps (4.6 ms)	19 fps (4.6 ms) * 118 fps (8.5 ms) *				38.9 fps (25.7 ms) *	
Lens mounting	C mount						M42 mount		
Field of vision, installation distance	Selecting a lens according to the field of vision and installation distance								
Ambient temperature range	Operating: 0 to 40 °C, Storage: -25 to 65 °C (with no icing or condensation)								
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)								
Weight	Approx.105 g Approx.110 g						Approx.320 g		
Accessories	Instruction manual								

* Frame rate in high speed mode when the camera is connected using two camera cables.

Digital CMOS Cameras

Model	FH-SM05R FH-SC05R							
Image Elements	CMOS image elements (1/2.5-inch equivalent)							
Color/Monochrome	Monochrome Color							
Effective Pixels	2592 (H) × 1944 (V)							
Imaging area $H \times V$ (opposing corner)	5.70 × 4.28 (7.13 mm)							
Pixel Size	2.2 (μm) × 2.2 (μm)							
Scan Type	Progressive							
Shutter Method	Rolling shutter							
Shutter Function	Electronic shutter; Shutter speeds can be set from 500 to 10000 ms in multiples of 50 μ s							
Frame Rate (Image Acquisition Time)	14 fps (71.7 ms)							
Lens Mounting	C mount							
Field of vision, Installation distance	Selecting a lens according to the field of vision and installation distance							
Ambient temperature range	Operating: 0 to +40°C Storage: -30 to 65°C (with no icing or condensation)							
Ambient humidity range	Operating: 35 to 85%RH Storage: 35 to 85%RH (with no condensation)							
Weight	Approx. 52 g							
Accessories	Instruction Sheet							

Digital CCD Cameras

Model	FZ-S	FZ-SC	FZ-S2M	FZ-SC2M	FZ-S5M2	FZ-SC5M2	
Image elements	Interline transfer read CCD image elements		Interline transfer read CCD image elements		Interline transfer read CCD image elements	ling all pixels, (2/3-inch equivalent)	
Color/Monochrome	Monochrome	Color	Monochrome	Color	Monochrome	Color	
Effective pixels	640 (H) × 480 (V)		1600 (H) × 1200 (V)		2448 (H) × 2044 (V)		
Imaging area H x V (opposing corner)	4.8 × 3.6 (6.0mm)		7.1×5.4 (8.9mm)	7.1 × 5.4 (8.9mm)		8.4 × 7.1 (11mm)	
Pixel size	7.4 (μm) × 7.4 (μm)		4.4 (µm) $ imes$ 4.4 (µm)		3.45 (µm) \times 3.45 (µm))	
Shutter function	Electronic shutter; select shutter speeds from 20 µs to 100 ms						
Partial function	12 to 480 lines		12 to 1200 lines		12 to 2044 lines		
Frame rate (Image Acquisition Time)	80 fps (12.5 ms)		30 fps (33.3 ms)		16 fps (62.5 ms)		
Lens mounting	C mount						
Field of vision, installation distance	Selecting a lens according to the field of vision and installation distance						
Ambient temperature range	Operating: 0 to 50 °C Storage: -25 to 65 °C (with no icing or condensation)		Operating: 0 to 40 °C Storage: -25 to 65 °C (with no icing or condensation)				
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)						
Weight	Approx. 55 g		Approx. 76 g		Approx.140 g		
Accessories	Instruction manual						

Small CCD Digital Cameras

Model	FZ-SF	FZ-SFC	FZ-SP	FZ-SPC
Image elements	Interline transfer reading all pixels, CCD image elements (1/3-inch equivalent)			
Color/Monochrome	Monochrome	Color	Monochrome	Color
Effective pixels	640 (H) × 480 (V)			
Imaging area H x V (opposing corner)	4.8×3.6 (6.0mm)			
Pixel size	7.4 (μm) × 7.4 (μm)			
Shutter function	Electronic shutter; select shutter	speeds from 20 μm to 100 ms		
Partial function	12 to 480 lines			
Frame rate (Image Acquisition Time)	80 fps (12.5ms)			
Lens mounting	Special mount (M10.5 P0.5)			
Field of vision, installation distance	Selecting a lens according to the field of vision and installation distance			
Ambient temperature range	Operating: 0 to 50 °C (camera amp) 0 to 45 °C (camera head) Storage: -25 to 65 °C (with no icing or condensation)			
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)			
Weight	Approx. 150 g			
Accessories	Instruction manual, installation bracket, Four mounting brackets (M2)			

High-speed Digital CCD Cameras

Model	FZ-SH	FZ-SHC	
Model			
Image elements	Interline transfer reading all pixels, CCD image elements (1/3-inch equivalent)		
Color/Monochrome	Monochrome	Color	
Effective pixels	640 (H) × 480 (V)		
Imaging area H x V (opposing corner)	4.8 × 3.6 (6.0mm)		
Pixel size	7.4 (μ m) \times 7.4 (μ m)		
Shutter function	Electronic shutter; select shutter speeds from 1/10 to 1/50,000 s		
Partial function	12 to 480 lines		
Frame rate (Image Acquisition Time)	204 fps (4.9ms)		
Field of vision, installation distance	Selecting a lens according to the field of vision and installation distance		
Ambient temperature range	Operating: 0 to 40 °C Storage: -25 to 65 °C (with no icing or condensation)		
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)		
Weight	Approx. 105 g		
Accessories	Instruction manual		


Intelligent Compact Digital CMOS Cameras

Model	FZ-SQ010F	FZ-SQ050F	FZ-SQ100F	FZ-SQ100N	
Image elements	CMOS color image elements (1/3-inch equivalent)				
Color/Monochrome	Color				
Effective pixels	752 (H) × 480 (V)				
Imaging area H x V (opposing corner)	4.51 × 2.88 (5.35mm)				
Pixel size	6.0 (μm) × 6.0 (μm)				
Shutter function	1/250 to 1/32,258				
Partial function	8 to 480 lines				
Frame rate (Image Acquisition Time)	60 fps (16.7 ms)				
Field of vision	7.5×4.7 to 13×8.2 mm	13×8.2 to 53×33 mm	53×33 to 240×153 mm	29×18 to 300×191 mm	
Installation distance	38 to 60 mm	56 to 215 mm	220 to 970 mm	32 to 380 mm	
LED class *	Risk Group2		L		
Ambient temperature range	Operating: 0 to 50 °C Storage: -25 to 65 °C				
Ambient humidity range	Operating and storage: 35% to 85% (with no condensation)				
Weight	Approx. 150 g Approx. 140 g				
	Mounting bracket (FQ-XL), polarizing filter attachment (FQ-XF1), instruction manual and warning label				

Applicable standards: IEC62471-2

Narrow View


FZ-SQ010F

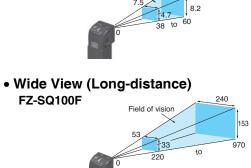

Field of vision

7.5

13

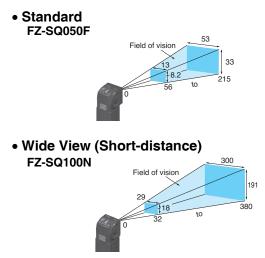

OMRON

Ratings and Specifications (Cable, Monitor)

Camera Cables

Model	FZ-VS3 (2 m)	FZ-VSB3 (2 m)	FZ-VSL3 (2 m)	FZ-VSLB3 (2 m)
Туре	Standard	Bend resistant	Right-angle	Bend resistant Right-angle
Shock resistiveness (durability)	10 to 150 Hz single amplitude 0.15 mm 3 directions, 8 strokes, 4 times			
Ambient temperature range	Operation and storage: 0 to 65 °C (with no icing or condensation)			
Ambient humidity range	Operation and storage: 40 to 70%RH (with no condensation)			
Ambient atmosphere	No corrosive gases			
Material	Cable sheath, connector: PVC			
Minimum bending radius	69mm	69mm	69mm	69mm
Weight	Approx. 170 g	Approx. 180 g	Approx. 170 g	Approx. 180 g

Cable Extension Unit

Model	FZ-VSJ
Power supply voltage *1	11.5 to 13.5 VDC
Current consumption *2	1.5 A max.
Ambient temperature range	Operating: 0 to 50 °C; Storage: -25 to 65 °C (with no icing or condensation)
Ambient humidity range	Operating and storage: 35 to 85% (with no condensation)
Weight	Approx. 240 g
Accessories	Instruction Sheet and 4 mounting screws

*1 A 12-VDC power supply must be provided to the Cable Extension Unit when connecting the Intelligent Compact Camera, or the Lighting Controller.

*2 The current consumption shows when connecting the Cable Extension Unit to an external power supply.

Touch Panel Monitor

Long-distance Camera Cables

Model	FZ-VS4 (15 m)	FZ-VSL4 (15 m)	
Туре	Standard	Right-angle	
Shock resistiveness (durability)	10 to 150 Hz single amplitude 0.15 mm 3 directions, 8 strokes, 4 times		
Ambient temperature range	Operation and storage: 0 to 65 °C (with no icing or condensation)		
Ambient humidity range	Operation and storage: 40 to 70%RH (with no condensation)		
Ambient atmosphere	No corrosive gases		
Material	Cable sheath, connector: PVC		
Minimum bending radius	78 mm		
Weight	Approx. 1400 g		

Encoder Cable

Model	FH-VR
Vibration resistiveness	10 to 150 Hz single amplitude 0.1 mm 3 directions, 8 strokes, 10 times
Ambient temperature range	Operation: 0 to 50 °C; Storage: -10 to 60 °C (with no icing or condensation)
Ambient humidity range	Operation and storage: 35 to 85%RH (with no condensation)
Ambient atmosphere	No corrosive gases
Material	Cable Jacket: Heat, oil and flame resistant PVC Connector: polycarbonate resin
Minimum bending radius	65 mm
Weight	Approx. 104 g

Model		FH-MT12
	Display area	12.1 inch
	Resolution	1024 (V) × 768 (H)
	Number of color	16,700,000 colors (8 bit/color)
	Brightness	500cd/m ² (Typ)
Major Function	Contrast Ratio	600:1 (Typ)
	Viewing angle	Left and right: each 80°, upward: 80°, downward: 60°
	Backlight Unit	LED, edge-light
	Backlight lifetime	About 100,000hour
	Touch panel	4wire resistive touch screen
External interface	Video input	analog RGB
	Touch panel signal	USB
	rouch parier signal	RS-232C
	Power supply voltage	24 VDC (21.6 to 26.4 VDC)
Ratings	Current consumption	0.5A
	Insulation resistance	Between DC power supply and Touch Panel Monitor FG: 20 M Ω or higher (rated voltage 250 V
	Ambient temperature range	Operating: 0 to 50°C, Storage: -20 to +65°C (with no icing or condensation)
	Ambient humidity range	Operating and Storage: 20 to 85 %RH (with no icing or condensation)
Operating	Ambient environment	No corrosive gas
environment	Vibration resistance	10 to 150 Hz, one-side amplitude 0.1 mm (Max. acceleration 15 m/s ²) 10 times for 8 minutes for each three direction
	Degree of protection	Panel mounting: IP65 on the front
Operation		Touch pen
	Mounting	Panel mounting, VESA mounting
Structure	Weight	Approx.2.6 kg
	Material	Front panel: PC/PBT, Front Sheet: PET, Rear case: SUS

Note: FH Series Sensor Controllers version 5.32 or higher is required.

Touch Panel Monitor Cables

Model	FH-VMDA (2 m)	FH-VUAB (2 m)	XW2Z-200PP-1 (2 m)	
Cable type	DVI-Analog Conversion Cable	USB Cable	RS-232C Cable	
Vibration resistance	10 to 150 Hz, one-side amplitude 0.1 mm,	10 to 150 Hz, one-side amplitude 0.1 mm, 10 times for 8 minutes for each three direction		
Ambient Temperature	Operating Condition: 0 to 50°C, Storage C	Dperating Condition: 0 to 50°C, Storage Condition: -10 to 60°C (with no icing or condensation)		
Ambient Humidity	Operating Condition: 35 to 85%RH, Storage	Operating Condition: 35 to 85%RH, Storage Condition: 35 to 85%RH (with no icing or condensation)		
Ambient environment	No corrosive gases	No corrosive gases		
Material	Cable outer sheath, Connector: PVC	Cable outer sheath, Connector: PVC Cable outer sheath: PVC, Connector: ABS/Ni Plating		
Minimum bend radius	36 mm	25 mm	59 mm	
Weight	Approx.220 g	Approx.75 g	Approx.162 g	

LCD Monitor

Model	FZ-M08
Size	8.4 inches
Туре	Liquid crystal color TFT
Resolution	1,024 × 768 dots
Input signal	Analog RGB video input, 1 channel
Power supply voltage	21.6 to 26.4 VDC
Current consumption	Approx. 0.7 A max.
Ambient temperature range	Operating: 0 to 50 °C; Storage: -25 to 65 °C (with no icing or condensation)
Ambient humidity range	Operating and storage: 35 to 85% (with no condensation)
Weight	Approx. 1.2 kg
Accessories	Instruction Sheet and 4 mounting brackets

LCD Monitor Cable

Model	FZ-VM	
Vibration resistiveness	10 to 150 Hz single amplitude 0.15 mm 3 directions, 8 strokes, 4 times	
Ambient temperature range	Operation: 0 to 50 °C; Storage: -20 to 65 °C (with no icing or condensation)	
Ambient humidity range	Operation and storage: 35 to 85%RH (with no condensation)	
Ambient atmosphere	No corrosive gases	
Material	Cable sheath: heat-resistant PVC Connector: PVC	
Minimum bending radius	75 mm	
Weight	Approx. 170 g	

Note: When you connect a LCD Monitor FZ-M08 to FH sensor controller, please use it in combination with a DVI-I -RGB Conversion Connector FH-VMRGB.

EtherCAT Communications Specifications

Item		Specifications			
Communications standard		IEC61158 Type 12			
Physical layer		100 BASE-TX (IEEE802.3)			
Modulation		Base band			
Baud rate		100 Mbps			
Topology		Depends on the specifications of the EtherCAT master.			
Transmission Media		Twisted-pair cable of category 5 or higher (double-shielded straight cable with aluminum tape and braiding)			
Transmission Distance		Distance between nodes: 100 m or less			
Node address setting		00 to 9			
External connection terminals		$RJ45 \times 2$ (shielded) IN: EtherCAT input data, OUT: EtherCAT output data			
Sand/reasive DDO data sizes	Input	56 to 280 bytes/line (including input data, status, and unused areas) Up to 8 lines can be set. *			
Send/receive PDO data sizes	Output	28 bytes/line (including output data and unused areas) Up to 8 lines can be set. *			
Mailhay data aire	Input	512 bytes			
Mailbox data size	Output	512 bytes			
Mailbox		Emergency messages, SDO requests, and SDO information			
Refreshing methods		I/O-synchronized refreshing (DC)			

This depends on the upper limit of the master.


Version Information

FH Series and Programming Devices

Use the latest version of Sysmac Studio Standard Edition/Vision Edition.

FH Series	Version of FH Series	Corresponding version of Sysmac Studio Standard Edition/Vision Edition				
	Version 5.71	Supported by version 1.18 or higher.				
	Version 5.60	Supported by version 1.15 or higher.				
_	Version 5.50	Supported by version 1.14.89 or higher.				
FH-3050 (-□) FH-1050 (-□)	Version 5.30	Supported by version 1.10.80 or higher.				
	Version 5.20	Supported by version 1.10 or higher.				
	Version 5.10	Supported by version 1.07.43 or higher.				
	Version 5.00	Supported by version 1.07 or higher. Not supported by version 1.06 or lower.				

Components and Functions

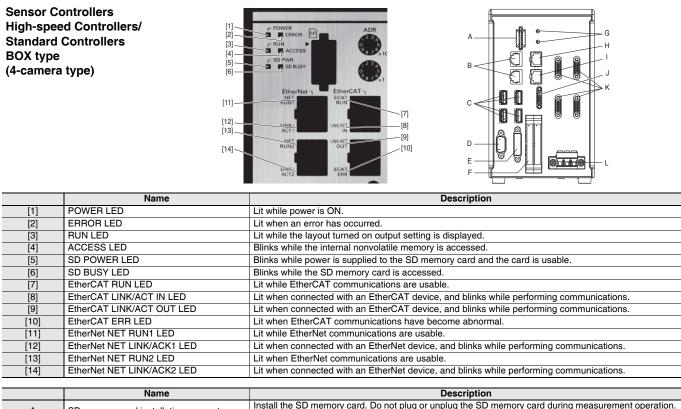



	Name	Description					
А	SD memory card installation connector	Install the SD memory card. Do not plug or unplug the SD memory card during measurement operation. Otherwise measurement time may be affected or data may be destroyed.					
		Connect an EtherNet device. Camera 2ch type EtherCAT EtherCAT EtherCAT EtherCAT					
В	EtherNet connector	Ethernet port and EtherNet/IP port are sharing use.					
С	USB connector	Connect a USB device. Do not plug or unplug it during measurement operation. Otherwise measurement time may be affected or data may be destroyed.					
D	RS-232C connector	Connect an external device such as a programmable controller.					
E	DVI-I connector	Connect a monitor.					
F	I/O connector (control lines, data lines)	Connect the controller to external devices such as a sync sensor and PLC.					
G	EtherCAT address setup volume	Used to set a node address (00 to 99) as an EtherCAT communication device.					
Н	EtherCAT communication connector (IN)	Connect the opposed EtherCAT device.					
I	EtherCAT communication connector (OUT)	Connect the opposed EtherCAT device.					
J	Encoder connector	Connect an encoder.					
K	Camera connector	Connect cameras.					
L	Power supply terminal connector	Connect a DC power supply. Wire the controller independently on other devices. Wire * the ground line Be sure to ground the controller alone.					

* Use the attachment power terminal connector (male) of FH-XCN series.

For details, refer to 5-3 Sensor Controller Installation on Vision System FH/FZ5 series Hardware Setup Manual (Z366).

Lite Controllers BOX type (4-camera type)

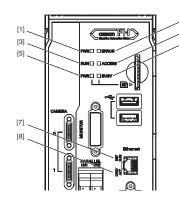



	LED name	Description
[1]	PWR LED	Lit while power is ON.
[2]	ERROR LED	Lit when an error has occurred.
[3]	RUN LED	Lit while the layout turned on output setting is displayed.
[4]	ACCESS LED	Blinks while the internal nonvolatile memory is accessed.
[5]	SD PWR LED	Lit while power is supplied to the SD memory card and the card is usable.
[6]	SD BUSY LED	Lit when access to the SD memory card.
[7]	Ethernet NET RUN LED	Lit while Ethernet communications are usable.
[8]	Ethernet NET LINK/ACT LED	Blinks when connected with an Ethernet device, and blinks while performing communications.

[4]

	Connector name	Description				
Α	SD memory card installation connector	Install the SD memory card. Do not plug or unplug the SD memory card during measurement operation Otherwise measurement time may be affected or data may be destroyed.				
в	USB 2.0 connector Connects to USB 2.0. Do not insert or remove during loading or writing of measurement or d The measurement time can be longer or data can be damaged.					
с	USB 3.0 connector	Connects to USB 3.0. Do not insert or remove during loading or writing of measurement or data. The measurement time can be longer or data can be damaged. USB 3.0 has a high ability to supply the bus power. Use the Sensor Controller by combining USB 3.0, faster transport can be realized.				
D	Ethernet connector	Connect an Ethernet device. Shared Ethernet port and EtherNet/IP port.				
Е	RS-232C connector Connect an external device such as a programmable controller.					
F	Monitor connector	Connect a monitor.				
G	Parallel connector (control lines, data lines)	Connect the controller to external devices such as a sync sensor.				
Н	Camera connector Connect a camera.					
I	Power supply terminal connector	Connect a DC power supply. Wire the controller independently on other devices. Wire * the ground line Be sure to ground the FH Sensor Controller alone.				

* Use the attachment power terminal connector (male) of FH-XCN-L series. For details, refer to 5-3 Sensor Controller Installation on Vision System FH/FZ5 series Hardware Setup Manual(Z366).

Processing Items


Group	Icon		Processing Item	Corresponding Page in the Group Catalog		lcon		Processing Item	Corresponding Page in the Catalog
	à	Search	Used to identify the shapes and calculate the position of measurement objects.	P16			Measurement Image Switching	To switch the images used for measurement. Not input images from camera again.	
	600	Flexible Search	Recognizing the shapes of workpieces with variation and detecting their positions.	P16 Input Image		Multi trigger	The Multi-trigger Imaging processing item captures multiple images at user-defined		
	***	Sensitive Search	Search a small difference by dividing the search model in detail, and calculating the correlation.		Input Image	뼺뼺	Multi-trigger Imaging	timings and executes parallel measurement for each image. Insert the Multi-trigger Imaging to the top of the flow.	
	-	ECM Search	Used to search the similar part of model form input image. Detect the evaluation value and position.			199 199	Multi-trigger Imaging Task	The Multi-trigger Imaging processing item captures multiple images at user-defined timings and executes parallel measurement for each image. Insert this	
	-	EC Circle Search	Extract circles using "round " shape information and get position, radius and quantity in high preciseness.				Position	processing item to the top of the processing which requires imaging for multiple times. Used when positions are differed.	
		Shape Search II	Used to search the similar part of model from input image regardless of environmental changes. Detect the evaluation value and position.	P16			Compensation	Correct measurement is performed by correcting position of input images. Used for processing images input from	P18
	, II , II , II , II , II , II , II , II		Robust detection of positions is possible at high-speed and with high precision incorporating				Filtering Backgrond	cameras in order to make them easier to be measured. To enhance contrast of images by	P18
	44	Shape Search III	environmental fluctuations, such as differences in individual shapes of the workpieces, pose fluctuations, noise superimposition and shielding.	P16		-	Suppression	extracting color in specified brightness. Track brightness change of entire	P18
	-	EC Corner	This processing item measures a corner position (corner) of a workpiece.			Test I	Brightness Correct Filter	screen and remove gradual brightness change such as uneven brightness.	P18
		Ec Cross	The center position of a crosshair shape is measured using the lines created by the edge information on each side of the crosshair.				Color Gray Filter	Color image is converted into monochrome images to emphasize specific color.	P18
	7	Classification	Used when various kinds of products on the assembly line need to be sorted and identified.	P16		•	Extract Color Filter	Convert color image to color extracted image or binary image.	P18
		Edge Position	Measure position of measurement objects according to the color change	P16		-	Anti Color Shading	To remove the irregular color/pattern by uniformizing max.2 specified colors.	P18
	+		in measurement area. Detect edges by color change in		Compensate image		Stripes Removal Filter II	Remove the background pattern of vertical, horizontal and diagonal stripes. Rectify the image by polar	P19
	UUU	Edge Pitch	measurement area. Used for calculating number of pins of IC and connectors. Measure peak/bottom edge position of	P16		III	Polar Transformation	transformation. Useful for OCR or pattern inspection printed on circle.	P18
	-	Scan Edge Position	workpieces according to the color change in separated measurement area.	P16			Trapezoidal Correction	Rectify the trapezoidal deformed image.	P18
	₽	Scan Edge Width	Measure max/min/average width of workpieces according to the color change in separated measurement area.	P16		- /	Machine Simulator	How the alignment marks would move on the image when each stage or robot axis is controlled can be checked. The registered model image and	
	Q	Circular Scan Edge Position	Measure center axis, diameter and radius of circular workpieces.	P16			Image Subtraction	measurement image are compared and only the different pixels are	
Measurement	\mathfrak{O}	Circular Scan Edge Width	Measure center axis, width and thickness of ring workpieces.	P16				extracted and converted to an image. Process the images acquired from cameras in	
		Intersection	Calculate approximate lines from the edge information on two sides of a square workpiece to measure the angle formed at the intersection of the two lines.	P16			Advanced filter	order to make them easier to measure. This processing item consolidates existing image conversion filtering into one processing item and adds extra functions.	P18
	&	Color Data	Used for detecting presence and mixed varieties of products by using color average and deviation.				Panorama	Combine multiple image to create one big image. Advanced arithmetic processing can	P18
		Gravity and Area	Used to measure area, center of gravity of workpices by extracting the color to be measured.			œ	Unit Macro	be easily incorporated into workflow as Unit Macro processing items.	P20
		Labeling	Used to measure number, area and gravity of workpieces by extracting registered color. Selecting one region of extracted Labeling,				Unit Calculation Macro	This function is convenient when the user wants to calculate a value using an original calculation formula or change the set value or system data of a processing item.	P20
		Label Data	and get that measurement. Area and Gravity position can be got and judged. Used for appearance measurement of plain-color measurement objects such	P16			Calculation	Used when using the judge results and measured values of Procitem which are registered in processing units.	
	M		as defects, stains and burrs. Check the defect on the object. Parameters			*	Line Regression	Used for calculating regression line from plural measurement coodinate.	
	M	Precise Defect	for extraction defect can be set precisely. Difference can be detected by overlapping	P16		, O	Circle Regression	Used for calculating regression circle from plural measurement coordinate.	
		Fine Matching	and comparing (matching) registered fine images with input images.	P16		G	Precise Calibration	Used for calibration corresponding to trapezoidal distortion and lens distortion.	P15
	AB	Character Inspect	Recognize character according correlation search with model image registered in [Model Dictionary].	P17		User	User Data	Used for setting of the data that can be used as common constants and variables in scene group data.	P21
	Date 08-02-1	Date Verification	Reading character string is verified with internal date.	P17		G	Set Unit Data	Used to change the ProcItem data (setting parameters,etc.) that has been set up in a scene.	
		Model Dictionary	Register character pattern as dictionary. The pattern is used in [Character Inspection]. Recognize 2D code and display where		Support measurement	:	Get Unit Data	Used to get one data (measured results, setting parameters,etc.) of ProcItem that	
		2DCode *2	the code quality is poor. Recognize barcode, verify and output	P17			Set Unit Figure	has been set up in a scene. Used for re-setting the figure data (model, measurement area)	
		Barcode *1 OCR	decoded characters. Recognize and read characters in	P17			-	registered in an unit. Used for get the figure data (model,	
		OCR User	images as character information. Register dictionary data to use for			*	Get Unit Figure	measurement area) registered in an unit. Used for displaying the information about	
	OCR	Dictionary Circle Angle	OCR. Used for calculating angle of inclination	17 17	P17		Trend Monitor	results on the monitor, facilitating to avoid NG and analyze causes.	P21
		Glue Bead	of circular measurement objects. You can inspect coating of a specified color	P17		1	Image Logging	Used for saving the measurement images to the memory and USB memory.	
·		Inspection Camera Image	for gaps or runoffs along the coating path. To input images from cameras. And set up			⊡ →	Image Conversion Logging	Used for saving the measurement images in JPEG and BMP format.	
		Input FH	the conditions to input images from camer- as. (For FH Sensor Controllers only)			5	Data Logging	Used for saving the measurement data to the memory and USB memory.	
Input Image		Camera Image Input HDR	Create high-dynamic range images by acquiring several images with different conditions.			i	Elapsed Time	Used for calculating the elapsed time since the measurement trigger input.	
	W	Camera Image Input HDRLite	HDR function for FZ-SQ Intelligent Compact Cameras.			X	Wait	Processing is stopped only at the set time. The standby time is set by the unit of [ms].	
	I	Camera Switch	To switch the cameras used for measurement. Not input images from cameras again.			2	Focus	Focus setting is supported.	P15

Group	lcon	Processing Item		Corresponding Page in the Catalog	Group	lcon		Correspon Processing Item Page in Catalo		
	2	Iris	Focus and aperture setting is supported. A part of the measurement flow is divided	P15			Conditional Branch	Used where more than two kinds of products on the production line need to detected separately.		
	100	Parallelize	into two or more tasks and processed in parallel to shorten the measurement time.			\$ 0	End	This ProcItem must be set up as the last processing unit of a branch.		
	B		his processing item is placed at the top of rocessing to be performed in parallel. part of the measurement flow is divided into				DI Branch	Same as ProcItem "Branch". But you can change the targets of conditional branching via external inputs.		
		Parallelize Task	two or more tasks and processed in parallel to shorten the measurement time. This processing item is placed immediately before processing to be performed in parallel		Branch	-	Control Flow Normal	Set the measurement flow processing into the wait state in which the specific no-protocol command can be executed.		
		Statistics	between Parallelize and Parallelize End. Used when you need to calculate an			₽	Control Flow PLC Link	Set the measurement flow processing into the wait state in which the specific PLC Link command can be executed.		
		Referrence Calib	average of multiple measurement results. Calibration data and distortion compensation data held under other				Control Flow Parallel	Set the measurement flow processing into the wait state in which the specific parallel command can be executed.		
		Position Data Calculation	processing items can be referenced. The specified position angle is calculated from the measured positions.	P14			Control Flow Fieldbus	Set the measurement flow processing into the wait state in which the specific Fieldbus command can be executed.		
	<u>+</u> //	Stage Data	Sets and stores data related to stages.			SWITCH	Selective Branch	Easily branch to multiple destinations.		
Support	\$ 0	Robot Data	Sets and stores data related to robots.			IJ	Data Output	Used when you need to output data to the external devices such as PLC or PC via serial ports.		
measurement		Vision Master Calibration	This processing item automatically calculates the entire axis movement amount of the control equipment necessary for calibration.				Parallel Data Output	Used when you need to output data to the external devices such as PLC or PC via parallel ports.		
		PLC Mastoer Calibration	Calibration data is created using a communication command from PLC.	P15	Output result	<u></u>	Parallel Judgement Output	Used when you need to output judgement results to the external		
	ţ	Convert Position Data	The position angle after the specified axis movement is calculated.	P14						
	/	Movement Single Position	The axis movement that is required to match the measured position angle to the reference position angle is calculated.	P14			Fieldbus Data Output	Outputs data to an external device, such as a Programmable Controller, through a fieldbus interface.		
		Movement Multi Points	The axis movements that are required to match the measured position angles to the corresponding reference	P14	P14 Display result	OK	Result Display	Used for displaying the texts or the figures in the camera image.		
			position angles are calculated. Obtains position/angle information by			2	Display Image File	Display selected image file.		
	+	Detection Point	referring to the coordinate values measured with the Measurement Processing Unit.			NG	Display Last NG Image	Display the last NG images.		
		Camera Calibration	By setting the camera calibration, the measurement result can be converted and output as actual dimensions.	P15	-		. ,	Display images of the tracking area as a panoramic image.		
	*	Data Save	The set data can be saved in the controller main unit or as scene data. The data is held even after the FH/FZ power is turned off.		Code 39,	codes that can be read : JAN/EAN/UPC (including add-on codes), 39, Codabar (NW-7), ITF (Interleaved 2 of 5), Code 93, Code 128, 128, GS1 DataBar (RSS-14 / RSS Limited / RSS Expanded), reacted				
	2. ²⁰	Conveyor Calibration	Conveyor Calibration is used to calibrate camera, conveyor, and robots for conveyor tracking application.			odes that can be read : Data Matrix (ECC200), QR Code				


Dimensions

Sensor Controllers

High-speed Controllers/Standard Controllers Box-type FH-3050/-3050-10/-3050-20 The 2-camera type has only two camera connectors, and the 8-camera type has eight camera connectore FH-1050/-1050-10/-1050-20

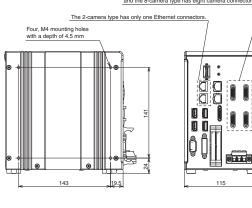


9

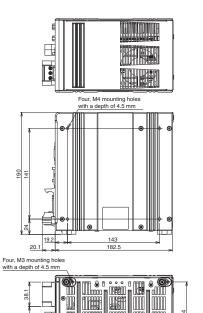




(Unit: mm)




OMRON

Lite Controllers BOX type FH-L550/-L550-10

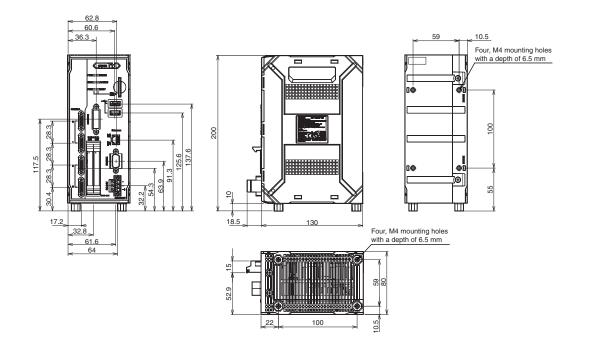



Cameras

High-speed Digital CMOS Camera

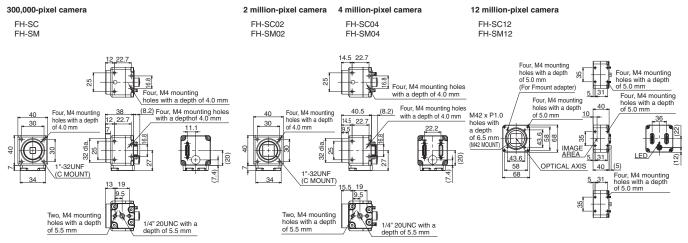


Digital CMOS Cameras

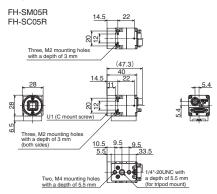


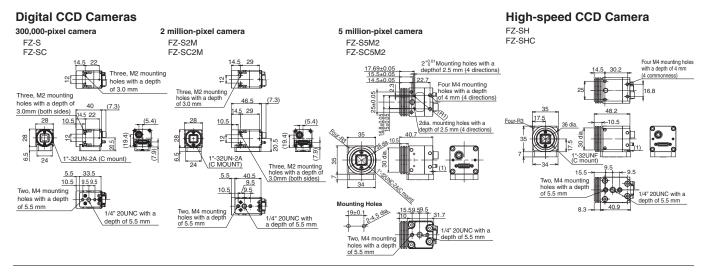



Small digital CCD cameras

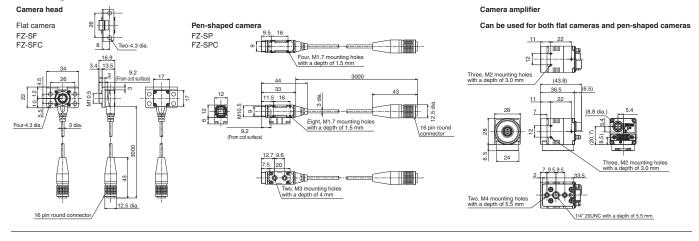


Intelligent Compact Digital CMOS Cameras

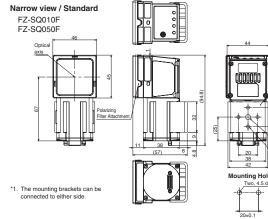


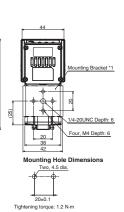

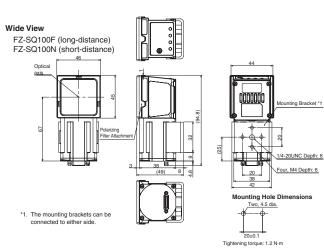

Cables

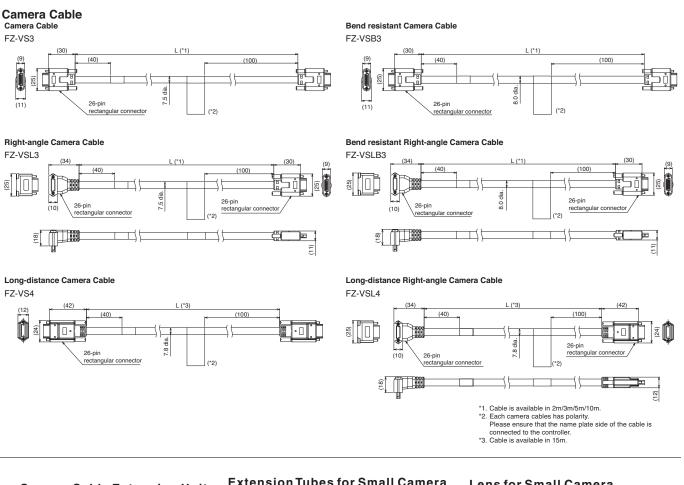

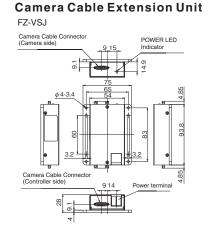


L1 (*1)

100

20


Extension Tubes for Small Camera

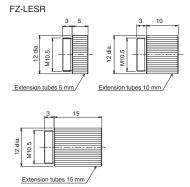

20

Lens for Small Camera

FZ-LES Series

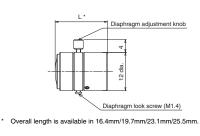



Encoder Cable

*1. Cable is available in 1.5 m

FH-VR


11.7



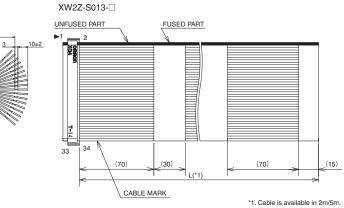


Touch Panel Monitor Panel cutout dimensions FH-MT12 26 . 7.74 7.74 58.5 12]+ 8-M4 EFFECTIVE SCREW LENGTH6 0 Panel cutout dimensions 100 322 (19) MOUNTING PLATE THICKNESS 1.6-4.8 161 37.5 307+1 5 A 48.52 30 100 264 249⁺¹ 32 ľ Note:1. Panel thickness : 1.6 to 4.8 mm 2. No burr allowed

DVI-Analog Conversion Cable for Touch Panel Monitor FH-VMDA




RS-232C Cable for Touch Panel Monitor

XW2Z-DDPP-1




LCD Monitor

FZ-M08

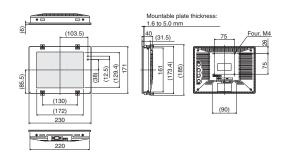


USB Cable for Touch Panel Monitor FH-VUAB



LCD Monitor Cable


FZ-VM




*1. Cable is available in 2m/5m.


DVI-I -RGB Conversion Connector







Optical Chart

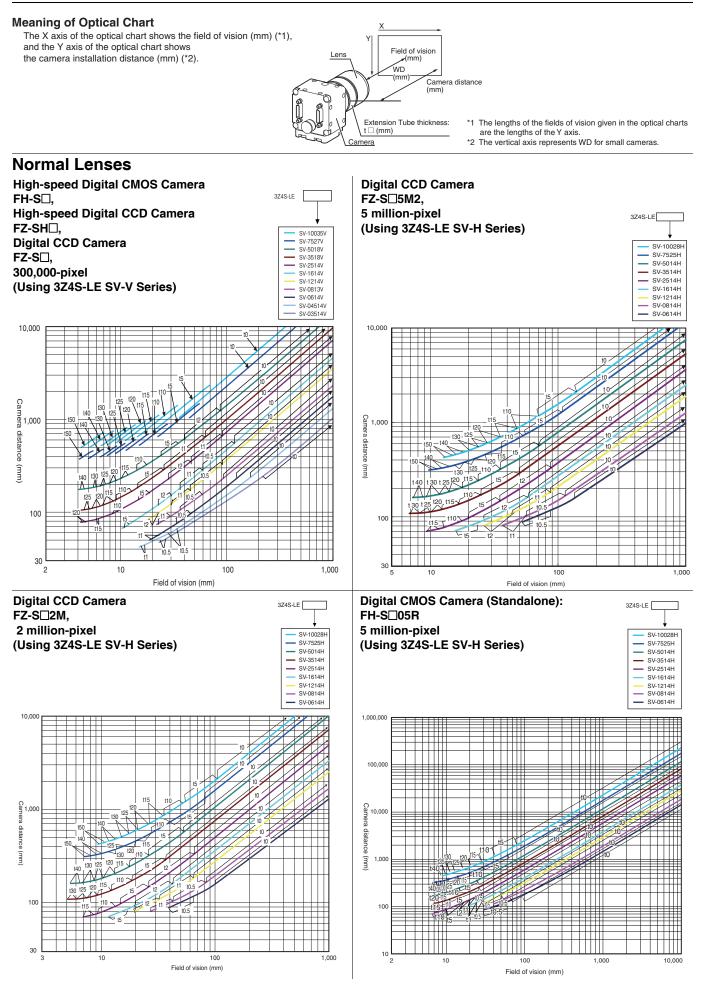

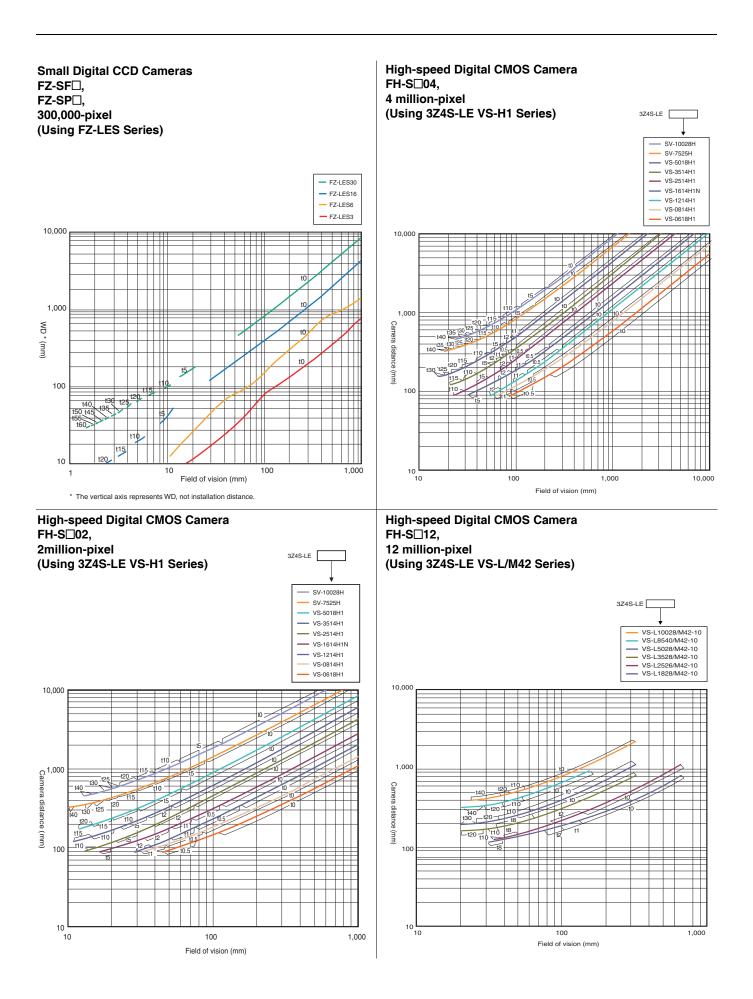

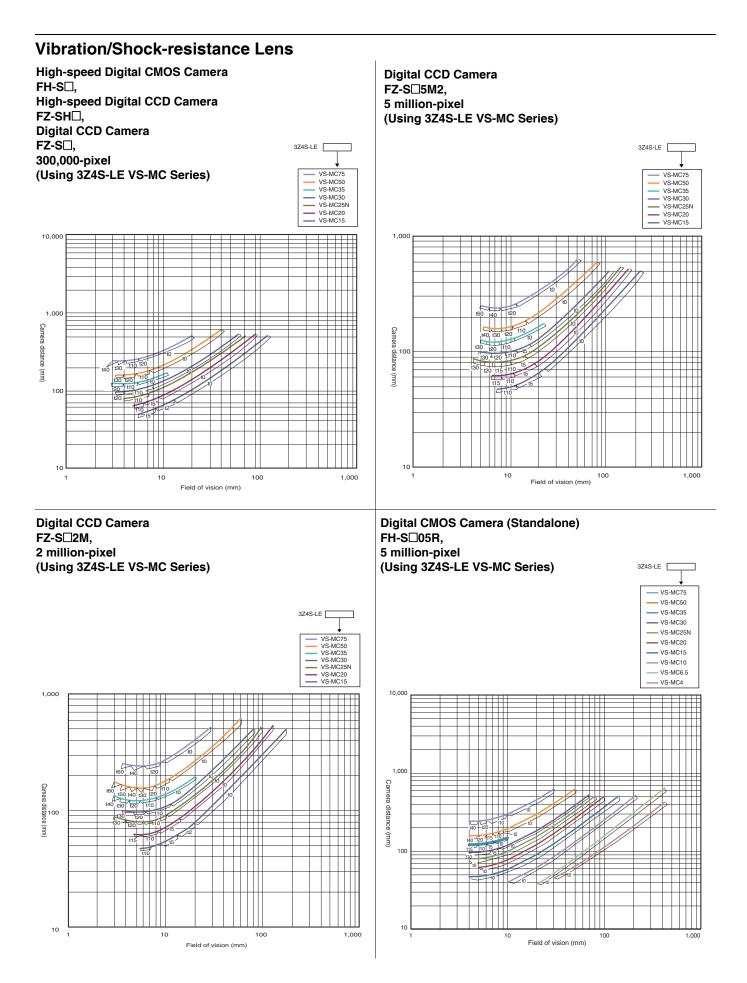

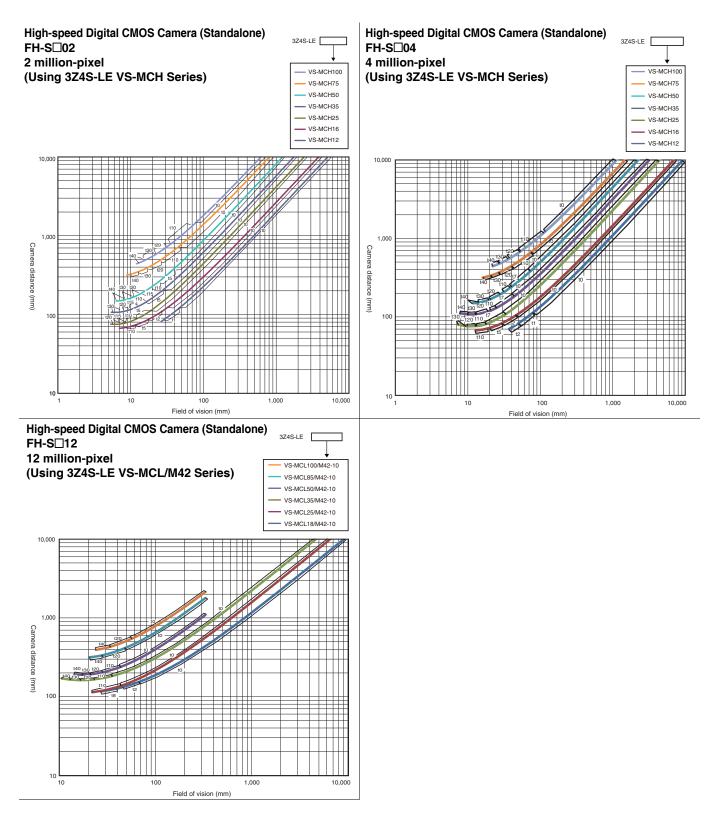

Related Manuals

Man.No.	Model number	Manual				
Z365	FH/FZ5	Vision System FH/FZ5 Series User's Manual				
Z341	FH/FZ5	Vision System FH/FZ5 series Processing Item Function Reference Manual				
Z342	FH/FZ5	Vision System FH/FZ5 Series User's Manual for Communications Settings				
Z343	FH	Vision System FH Series Operation Manual for Sysmac Studio				
Z366	FH/FZ5	Vision System FH/FZ5 series Hardware Setup Manual				
Z367	FH/FZ5	Vision System FH/FZ5 series Macro Customize Functions Programming Manual				

Terms and Conditions Agreement

Read and understand this catalog.

Please read and understand this catalog before purchasing the products. Please consult your OMRON representative if you have any questions or comments.

Warranties.

(a) Exclusive Warranty. Omron's exclusive warranty is that the Products will be free from defects in materials and workmanship for a period of twelve months from the date of sale by Omron (or such other period expressed in writing by Omron). Omron disclaims all other warranties, express or implied.

(b) Limitations. OMRON MAKES NO WARRANTY OR REPRESENTATION, EXPRESS OR IMPLIED, ABOUT NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE OF THE PRODUCTS. BUYER ACKNOWLEDGES THAT IT ALONE HAS DETERMINED THAT THE PRODUCTS WILL SUITABLY MEET THE REQUIREMENTS OF THEIR INTENDED USE.

Omron further disclaims all warranties and responsibility of any type for claims or expenses based on infringement by the Products or otherwise of any intellectual property right. (c) Buyer Remedy. Omron's sole obligation hereunder shall be, at Omron's election, to (i) replace (in the form originally shipped with Buyer responsible for labor charges for removal or replacement thereof) the non-complying Product, (ii) repair the non-complying Product, or (iii) repay or credit Buyer an amount equal to the purchase price of the non-complying Product; provided that in no event shall Omron be responsible for warranty, repair, indemnity or any other claims or expenses regarding the Products unless Omron's analysis confirms that the Products were properly handled, stored, installed and maintained and not subject to contamination, abuse, misuse or inappropriate modification. Return of any Products by Buyer must be approved in writing by Omron before shipment. Omron Companies shall not be liable for the suitability or unsuitability or the results from the use of Products in combination with any electrical or electronic components, circuits, system assemblies or any other materials or substances or environments. Any advice, recommendations or information given orally or in writing, are not to be construed as an amendment or addition to the above warranty.

See http://www.omron.com/global/ or contact your Omron representative for published information.

Limitation on Liability; Etc.

OMRON COMPANIES SHALL NOT BE LIABLE FOR SPECIAL, INDIRECT, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, LOSS OF PROFITS OR PRODUCTION OR COMMERCIAL LOSS IN ANY WAY CONNECTED WITH THE PRODUCTS, WHETHER SUCH CLAIM IS BASED IN CONTRACT, WARRANTY, NEGLIGENCE OR STRICT LIABILITY.

Further, in no event shall liability of Omron Companies exceed the individual price of the Product on which liability is asserted.

Suitability of Use.

Omron Companies shall not be responsible for conformity with any standards, codes or regulations which apply to the combination of the Product in the Buyer's application or use of the Product. At Buyer's request, Omron will provide applicable third party certification documents identifying ratings and limitations of use which apply to the Product. This information by itself is not sufficient for a complete determination of the suitability of the Product in combination with the end product, machine, system, or other application or use. Buyer shall be solely responsible for determining appropriateness of the particular Product with respect to Buyer's application, product or system. Buyer shall take application responsibility in all cases.

NEVER USE THE PRODUCT FOR AN APPLICATION INVOLVING SERIOUS RISK TO LIFE OR PROPERTY OR IN LARGE QUANTITIES WITHOUT ENSURING THAT THE SYSTEM AS A WHOLE HAS BEEN DESIGNED TO ADDRESS THE RISKS, AND THAT THE OMRON PRODUCT(S) IS PROPERLY RATED AND INSTALLED FOR THE INTENDED USE WITHIN THE OVERALL EQUIPMENT OR SYSTEM.

Programmable Products.

Omron Companies shall not be responsible for the user's programming of a programmable Product, or any consequence thereof.

Performance Data.

Data presented in Omron Company websites, catalogs and other materials is provided as a guide for the user in determining suitability and does not constitute a warranty. It may represent the result of Omron's test conditions, and the user must correlate it to actual application requirements. Actual performance is subject to the Omron's Warranty and Limitations of Liability.

Change in Specifications.

Product specifications and accessories may be changed at any time based on improvements and other reasons. It is our practice to change part numbers when published ratings or features are changed, or when significant construction changes are made. However, some specifications of the Product may be changed without any notice. When in doubt, special part numbers may be assigned to fix or establish key specifications for your application. Please consult with your Omron's representative at any time to confirm actual specifications of purchased Product.

Errors and Omissions.

Information presented by Omron Companies has been checked and is believed to be accurate; however, no responsibility is assumed for clerical, typographical or proofreading errors or omissions.

Sysmac is a trademark or registered trademark of OMRON corporation in Japan and other countries for OMRON factory automation products. Think&See is a trademark or registered trademark of OMRON Corporation in Japan and other countries. EtherCAT® is registered trademark and patented technology, licensed by Beckhoff Automation GmbH, Germany. Windows, Microsoft® Visual Studio® are either registered trademarks or trademarks of Microsoft Corporation in the United States and/or other countries. The Microsoft .NET software is used to connect users, information, systems, and devices. QR Code is registered trademarks of DENSO WAVE INCORPORATED in Japan and in other countries. Other company names and product names in this document are the trademarks or registered trademarks of their respective companies. The product photographs and figures that are used in this catalog may vary somewhat from the actual products.

Microsoft product screen shot(s) reprinted with permission from Microsoft Corporation.

Note: Do not use this document to operate the Unit.

OMRON Corporation Industrial Automation Company Kyoto, JAPAN

Contact: www.ia.omron.com

Regional Headquarters OMRON EUROPE B.V. Wegalaan 67-69, 2132 JD Hoofddorp The Netherlands Tel: (31)2356-81-300/Fax: (31)2356-81-388

OMRON ASIA PACIFIC PTE. LTD. No. 438A Alexandra Road # 05-05/08 (Lobby 2), Alexandra Technopark, Singapore 119967 Tel: (65) 6835-3011/Fax: (65) 6835-2711

OMRON ELECTRONICS LLC 2895 Greenspoint Parkway, Suite 200 Hoffman Estates, IL 60169 U.S.A. Tel: (1) 847-843-7900/Fax: (1) 847-843-7787

OMRON (CHINA) CO., LTD. Room 2211, Bank of China Tower, 200 Yin Cheng Zhong Road, PuDong New Area, Shanghai, 200120, China Tel: (86) 21-5037-2222/Fax: (86) 21-5037-2200

Authorized Distributor:

© OMRON Corporation 2013-2016 All Rights Reserved. In the interest of product improvement, specifications are subject to change without notice.

CSM_18_2_0417 Cat. No.Q197-E1-06